

VEHICLE REGISTER

REGISTRATION NUMBER:	MCKDOG	NHVAS Label Number:	A104574
Registered Owner:	McKenna Group Pty Ltd		Suby Y/N
State of Registration:	QLD		
Vin Number:	6FMT14H83JD809789		
Manufacturer:	Mack Superliner		
Type of Unit:	Prime Mover		
Construction Date:	2018		
Tare Weight:	10240		
Date Joining NHVAS Maintenance	07/12/2019		
Date Leaving NHVAS Maintenance			
SCHEDULED SERVICE INTERVALS			
A.	12,000klms	B.	20,000klms
C.	200,000klms	D.	
Registered GVM/GCM	28500 : 90000		
Manufacturers GVM/GCM	28500 : 90000		
Date Joining NHVAS Mass			
Date Leaving NHVAS Mass			

(MUST BE COMPLETED FOR EACH UNIT)

Service Report Register

MACK SUPERLINER

REGO MCKDOG / NHVAS # A104574

Date	Service Report	HRS/KLMS	Description	Serviced By:
16/10/2019			Purchased Brand New From JT Fossey Pty Ltd	
7/12/2019			Joined NHVAS	
10/03/2020	3006	10,100	A Service Completed	Matt Harries
2/06/2020	3031	21,976	B Service Completed	Matt Harries
10/10/2020	3033	34,245	Complete C Service	Matt Harries
23/10/2020	AS321	35,802	Annual Inspection Completed	Matt Harries
23/12/2020	Inv 48391	41,975	2 New Tyres Fitted	Tim's Tyres
13/01/2021	3034	42,612	Service A Completed	Matt Harries
4/06/2021	Inv 63621	59,489	Serviced by Northside Diesel	Northside Diesel
31/01/2022	3063	77,486	Fit 4 New Batteries	Andrew Brandt
20/10/2021	Annual		Annual Inspection Completed	Andrew Brandt
4/03/2022	3075	79,616	Service B Completed	Andrew Brandt
7/06/2022	3084	86,254	Replace right side exhaust elbow at bottom of stack. Replace left side exhaust stack.	Andrew Brandt
20/06/2022	3090	91,600	Service B Completed	Andrew Brandt
15/10/2022	Annual	107,592	Annual Inspection Completed	Andrew Brandt
15/10/2022	3116	107,592	Service C Completed	Andrew Brandt
22/03/2023	3133	129,488	Service B Completed Replaced Air Dryer Filter, Found hole in exhaust y piece ordered	Andrew Brandt
4/05/2023	12079	133,604	2 New Tyres Fitted	All Coast Tyres
6/09/2023	G014372		2 New Tyres Fitted	All Coast Tyres
25/10/2023	G015225		2 New Tyres Fitted	All Coast Tyres
24/10/2023	3171	149580	Service C Completed	Andrew Brandt
24/10/2023	Annual	149580	Annual Inspection Completed	Andrew Brandt
9/01/2024	3176	155513	Replace faulty battery isolator switch	Andrew Brandt
11/03/2024	104393		1 New Tyre Fitted	Total Tyres & Auto
12/06/2024	G019269	173170	2 New Tyres Fitted	All Coast Tyres
13/06/2024	G019305		1 New Tyre Fitted	All Coast Tyres
18/06/2024	G019367	174796	2 New Tyres Fitted	All Coast Tyres
2/07/2024	3206	176442	Service B Completed	Andrew Brandt
21/10/2024	3235	187454	Service C Completed	Andrew Brandt
21/10/2024	Annual	187454	Annual Inspection Completed	Andrew Brandt
26/11/2024	106682		2 Tyres and Drive Puncture	Total Tyres & Auto
16/12/2024	6508658	191340	Replace ESP Valve	Western Truck Grp
9/01/2025	G022805		1 New Tyre Fitted	All Coast Tyres
7/02/2025	2260		Repair Coil Mounts. Repair Fuel Tank Step. Repair Muffler guard. C/O Spring Brake	Draper Mechanical
18/03/2025	8305698	199401	Rework damaged air con condensor. Inspect and rectify coolant leak. Rectify engine light, found broken wires, replace wires to pins. Replace engine oil temp sensor	Western Truck Grp
15/05/2025	3267	203796	Service C Completed	Andrew Brandt



**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3267

Day: Thursday Date: 15/05/2025

**MCKENNA GROUP
PTY LTD**

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. Mck74	Klms: 203,796km	Hours:
----------------------------------	--------------	--------------------	-----------------	--------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)	☒	☒
Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and max).
Grease all lubrication points.	☒	Drain condensation from air tanks.
Lift cab/hood, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.
Check/top up engine oil and coolant level.	☒	Visual check of airbag suspension where fitted.
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.
Check driveline and universal joints.	☒	Check number plates, all labels for due date condition and security.
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)
Check battery terminals and security.	☒	
Inspect brake lining wear/travel and adjust if required.	☒	

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/travel and adjust if required.		Visual check of airbag suspension where fitted.
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.		

Notes:

☒ B SERVICE CHECKLIST Including items from Checklist A

☐ TRUCK (Approx 20,000km)	☒	☒
All components of "A" Service.	☒	Check wear/movement in pinman arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	☒	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and maxi system.
Test coolant and change water filters if required.	☒	
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (if Applicable)
Check clutch linkage, clutch brake operation and adjustment.	☒	
Check front steering hub oil level.	☒	

☒ C SERVICE CHECKLIST Including items from Checklist A and B

☐ TRUCK (Approx 200,000kms or annually)	☒	☒
All components of "A" and "B" Services.	☒	Change PTO Hydraulic filters.
Change power steering oil and filter.	☒	Service air dryers where applicable.
Change transmission oil and filter (300,000km for Synthetic Oil).	☒	Re-torque all "U" bolts and cross members.
Change differential oil and filter.	☒	Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	☒	
Check clutch linkage, clutch brake operation and adjustment.	☒	

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *Andrew Brandt*

Date: 15/05/2025

OFFICE USE ONLY Entered By: *Amara Smith*

Name:

Signature: *Amara Smith*

Date: 16.5.25


Western Truck Group Pty Ltd

ABN: 31 624 305 353 / ACN: 624 305 353

info@wtg.com.au www.wtg.com.au

 CBA Bank Details: BSB 064433 Account 11147264
 ARC AU#45908

WORKSHOP TAX INVOICE
Invoice To:

13186

 BRENDAN MCKENNA EARTHMOVING PT
 11 MONTEGO COURT

EATONS HILL QLD

4037

Page no.....: 1

Invoice number....: 8305698 - 000003

Invoice Date.....: 18/03/25

Customer Ref.....: BH

Due Date.....:

Terms.....: 30 Days EOM

Our reference....: 3516316 - 000003

Advisor was.....:

Blake Hertel

Remarks.....:

Vehicle Details

Reg Number: MCKDOG MACK (1) CLX 6*4

Chassis No: 809789

Odometer...: 199,401 Engine Hrs: 4,224

Contract...:

VIN: 6FMT14H83JD809789

Fleet:

Operation	List	Nett	--Quantity--	
/Part Number Description	Price	Price	Invcd B/Ord	Amount
870 REWORK DAMAGED AIR CON CONDENSOR (32)				
VO 22386057 CONDENSER (32)			1.0	Non chargeable
VO 82781567 RECEIVER D (32)			1.0	Non chargeable
VO 20443754 O-RING (32)			6.0	Non chargeable
VO 82356754 O-RING (32)			1.0	Non chargeable
VO 20443759 O-RING (32)			1.0	Non chargeable
OTH OGX395-R134A R134A Gas (32)			13.0	Non chargeable

BRAKE ROLLER TESTER

& SHAKER AVAILABLE

ONSITE

Phone: 07 5438 8866

service.sunshinecoast@wtg.com.au

Sub Total Parts...:

Sub Total Labour.:

T O T A L

0.00

 Toowoomba head office
 373 Anzac Ave, Toowoomba QLD 4350
 (07) 4630 1977

 Sunshine Coast
 24-26 Empire Cres, Chevallum QLD 4555
 (07) 5438 8866



Western Truck Group Pty Ltd

ABN: 31 624 305 353 / ACN: 624 305 353

info@wtg.com.au www.wtg.com.au

CBA Bank Details: BSB 064433 Account 11147264

ARC AU#45908

WORKSHOP TAX INVOICE

Invoice To:

13186

BRENDAN MCKENNA EARTHMOVING PT

11 MONTEGO COURT

EATONS HILL QLD

4037

Page no.....: 1

Invoice number....: 6509013 - 000003

Invoice Date.....: 18/03/25

Customer Ref.....: BH

Due Date.....:

Terms.....: 30 Days EOM

Our reference....: 3516275 - 000003

Advisor was.....:

Blake Hertel

Remarks.....:

Vehicle Details

Reg Number: MCKDOG MACK (1) CLX 6*4

Chassis No: 809789

Odometer...: 199,401

Engine Hrs: 4,224

Contract...:

VIN: 6FMT14H83JD809789

Fleet:

Operation	List	Nett	--Quantity--	
/Part Number	Price	Price	Invced B/Ord	Amount
262				1387.50
COOLANT LEAK USING 5LTRS EVERY DAY				
INSPECT AND RECTIFY				
OWNERS NUMBER 0417 710 806				
COMPLAINT: COOLANT LEAKS				
CAUSE: COOLANT HOSE & CLAMP DAMAGED				
CORRECTION: DRAIN COOLANT, REMOVE RADIATOR TO OPEN UP				
SPACE FOR THE CONDENSOR, AIR LINES, FAN COVER, INTERCOOLER				
HOSES, ETC				
FAST CONNECTORS FOR THE TRANSMISSION COOLANT PIPE ARE				
STUCK AND TAKE SOME TIME TO CAREFULLY REMOVE				
SEPARATE INTERCOOLER				
PRESSURE TEST ON TRANSMISSION RADIATOR - IS BLOWING COOLANT				
REPLACE TRANSMISSION RADIATOR				
CLEAN RADIATOR AND INTERCOOLER				
RE-INSTALL WITH NEW BOLTS FOR THE TRANSMISSION RADIATOR				
DUE TO ORIGINAL BOLTS BEING RUSTY AND STICKING				
CLEAN AND GREASE TRANSMISSION COOLANT HOSE FITTING AND				
RE-INSTALL EVERYTHING				
CONDENSOR IS BROKEN				
FILL UP COOLANT AND PRESSURE TEST				
START ENGINE AND PLUG IN LAPTOP				
CHECK FAULTS - OKAY				
REPLACE COOLANT HOSE & CLAMP				
FILL UP COOLANT				
VO 21922388	HOSE CLAMP	37.99	37.99 2.0	75.98

Toowoomba head office
373 Anzac Ave, Toowoomba QLD 4350
(07) 4630 1977

Sunshine Coast
24-26 Empire Cres, Chevallum QLD 4555
(07) 5438 8866


Western Truck Group Pty Ltd

ABN: 31 624 305 353 / ACN: 624 305 353

info@wtg.com.au www.wtg.com.au

 CBA Bank Details: BSB 064433 Account 11147264
 ARC AU#45908

WORKSHOP TAX INVOICE
Invoice To:

13186

 BRENDAN MCKENNA EARTHMOVING PT
 11 MONTEGO COURT

EATONS HILL QLD

4037

Page no.....: 3

Invoice number....: 6509013 - 000003

Invoice Date.....: 18/03/25

Customer Ref.....: BH

Operation			List	Nett	--Quantity--	
/Part Number	Description		Price	Price	Invced B/Ord	Amount
VO 23626042	AIR VALVE BLUE		719.44	719.44	1.0	719.44
VO 20579690	GASKET		9.58	9.58	1.0	9.58
VO 88800233	AIR LINE REMOVA		14.47	14.47	1.0	14.47
AU2 WUR05555101	JOINER HEAT SHR		1.43	1.43	4.0	5.72
VO 8159012	SEAL		3.50	3.50	4.0	14.00
VO 984847	CABLE TERMINAL		2.82	2.82	6.0	16.92
VO 984846	CABLE TERMINAL		2.52	2.52	4.0	10.08
AU2 WUR05555101	JOINER HEAT SHR		1.43	1.43	4.0	5.72
AU2 WUR088500212	JOINER 1/2		19.77	19.77	1.0	19.77
AU2 CHE23068346	VOLVO VDS4.5 BU		7.47	7.47	5.0	37.35
Subtotal: 002 Order Job 002:						2613.97
91	Workshop Consumables					177.05

.	BRAKE ROLLER TESTER	.				
.	& SHAKER AVAILABLE	.				
.	ONSITE	.				
.	Phone: 07 5438 8866	.				
.	service.sunshinecoast@wtg.com.au	.				
					Sub Total Parts...	3596.88
					Sub Total Labour..	2682.50
					Sub Total Other...	177.05
					GST.....	645.66
					Rounding.....	0.04-
					=====	
					T O T A L	7102.05
					=====	

 Toowoomba head office
 373 Anzac Ave, Toowoomba QLD 4350
 (07) 4630 1977

 Sunshine Coast
 24-26 Empire Cres, Chevallum QLD 4555
 (07) 5438 8866



10/2 AT

TAX INVOICE

Brendan McKenna Earthmoving Pty Ltd
11 Montego Court
EATONS HILL QLD 4037
AUSTRALIA

Invoice Date
7 Feb 2025

Invoice Number
INV-2260

ABN
93 579 306 319

Draper Mechanical & Welding
Services Pty Ltd
Ben: 0409 036 159
dmwservices14@gmail.com

Description	Quantity	Unit Price	GST	Amount AUD
Mack Superliner. Repair Suzi coil mounts. Repair fuel tank step D/S. Repair muffler guard. Diagnose Air system fault. C/O spring brake valve.	5.50	125.00	10%	687.50
spring brake valve	1.00	745.89	10%	745.89
Silencer	1.00	78.45	10%	78.45
Check Valve	1.00	68.12	10%	68.12
Subtotal				1,579.96
TOTAL GST 10%				158.00
TOTAL AUD				1,737.96

Due Date: 14 Feb 2025
Thank you for your business.

EFT Banking Details

Account Name: Draper Mechanical & Welding Services Pty Ltd
ANZ Bank
BSB: 014 740
Account Number: 459296634

Reference is Invoice Number.

All Coast Tyre Solutions - Gympie

50/56 Mellor Street
Gympie QLD 4570
Ph: (07) 5482 6633
Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions
ABN: 18 718 867 756



Tax Invoice G022805

Date: 09 Jan 25

Customer: BRENDANMCKENNAEARTHMOVING

Terms: 30 Days from Statement

BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT

EATONS HILL QLD 4037

Written By: Craig Mattingley
Salesperson:

Deliver To: SAME

Contact: Brendan
Mobile: 0417 710 806 Home Ph:
Bus Ph: Fax:
Email: accounts@mckgroup.com.au
Odometer In: 0 Out: 0
Vehicle Details:

Customer PO#:

Item	Description	QTY	Unit Price (Exd GST)	Unit Price (Ind GST)	Total (Ind GST)
GO11225EZ373	GOODRIDE GOODRIDE 11R22.5 EZ373 16PR 148/145J DRIVE MIXED O	1	461.82	508.00	508.00
AS_6549997	Fitting - Truck Tyre Steel wheel	1	27.27	30.00	30.00

Payment Method: OnAccount=538.00

BANK DETAILS

Account Name ALL COAST TYRE SOLUTIONS

BSB: 064014

Account No. 10040117

Please include your CUSTOMER ID as your Ref.

Total includes GST of 48.91

Totals Items 1

Total \$ 538.00

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:

Warranty provisions

Customer Service Standards

Quality Management Systems

Customer Complaints System

If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Manufacturers (Australia) Limited's terms and conditions of sale (2007). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for these products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:



Western Truck Group Pty Ltd

ABN: 31 624 305 353 / ACN: 624 305 353

info@wtg.com.au www.wtg.com.au

CBA Bank Details: BSB 064433 Account 11147264

ARC AU#45908

WORKSHOP TAX INVOICE

Invoice To:
13186
BRANDAN MCKENNA EARTHMOVING PT
11 MONTEGO COURT
EATONS HILL QLD 4037

Page no.....: 1

Invoice number....: 6508658 - 000003

Invoice Date.....: 16/12/24

Customer Ref.....: CW

Due Date.....:

Terms.....: 30 Days EOM

Our reference.....: 3515292 - 000003

Advisor was.....:

Craig Wilson

Remarks.....:

Vehicle Details

Reg Number: MCKDOG MACK (1) CV

Chassis No: 809789

Odometer...: 191,340 Engine Hrs: 4,040

Contract...:

VIN: 6FMT14H83JD809789

Fleet:

Operation /Part Number	Description	List Price	Nett Price	--Quantity-- Invcd B/Ord	Amount
4002000	INTERMITTENT GEARS WHEN TAKING OFF DIAGNOSE PLEASE				437.50
VO 21850098	RELAY VALVE TRA COMPLAINT- INTERMITTENT GEARS CAUSE- ESP BRAKE VALVE CORRECTION- TEST DRIVE TO FIND FAULT- BRAKES COMING ON BY THEMSELF- CHECK AND FIND STEER AXLE HOT- ESP VALVE CAUSING FAULT. REMOVE AND REPLACE ESP VALVE AND TEST OPERATION ALL OK.	951.74	951.74	1.0	951.74
Subtotal: 001 Order Job 001:					1389.24
91	Workshop Consumables				28.88

.	BRAKE ROLLER TESTER				
.	& SHAKER AVAILABLE				
.	ONSITE				
.	Phone: 07 5438 8866				
.	service.sunshinecoast@wtg.com.au,				
Sub Total Parts...					951.74
Sub Total Labour...					437.50
Sub Total Other...					28.88
GST.....					141.81
Rounding.....					0.03-
T O T A L					1559.90

Toowoomba head office
373 Anzac Ave, Toowoomba QLD 4350
(07) 4630 1977

Sunshine Coast
24-26 Empire Cres, Chevallum QLD 4555
(07) 5438 8866

2 / 5 Lear Jet Drive
Caboolture Queensland 4510
ABN: 85660980414
Tel: 07 5499 1049
Fax: 07 5499 3643
Email: sales@ttaa.com.au
Website:
www.totaltyresandauto.com.au



TAX INVOICE

Tax Invoice Number: TTA - INV106682
Date: 26/11/2024
Due Date: 30/12/2024

BILL TO:

Brendan McKenna Earthmoving Pty-Ltd
11 Montego Court
Eatons Hill Queensland 4037
ABN: 94 163 887 563
Tel: Angela - 0418717154
Email: angela@mckgroup.com.au

FOR:

2 x Steers and Drive Puncture - Red
Road Yard
Model: MACK SUPERLINER
Reg No: MCKDOG
Body Type: PRIME MOVER
Year: 2018

Description	Qty.	Unit Price	GST	Amount
TE29580225TKAMII - Techking 295/80R22.5 TKAM 152/149M 18PR	2.0	\$535.00	\$97.27	\$1,070.00
BALBEADPEROUNCE - Balance Bead Per ounce	24.0	\$2.00	\$4.36	\$48.00
PUNCT - Puncture Repair - Truck Drive Tyre Position 8	1.0	\$50.00	\$4.55	\$50.00

Subtotal	\$1,061.82
GST	\$106.18
Total	\$1,168.00
Paid	\$0.00
Balance Due	\$1,168.00

Please Note our Store Address has changed to 2/5 Lear Jet Drive Caboolture 4510.

Direct Deposit

BSB: 014309
ACC: 433109765

Please use your invoice number as your payment reference when paying via Direct deposit/bank transfer. Thank-you for your business.

The Tyre Product Stewardship Scheme is a government supported scheme focused on responsible tyre disposal, and the sustainable management of end-of-life tyres. We have been an active member of the scheme since January 2023. Together, we aim to change the way end-of-life tyres are managed and make our industry more environmentally sustainable.

Heavy Vehicle Inspection Checklist

This checklist is used to complete a vehicle inspection that meets maintenance management standard 4 criteria(4). The inspection must be completed or supervised by a suitably qualified person whose name and signature must appear on the form.

Registration #	MCKDOG	Owner's Details	
Reason for Inspection	Annual Inspection	Inspection location	Red Road, Beerburrum
Inspection Date	21/10/2024	Make	Mack
Inspection Time	12pm	Model	Superliner
Odometer	187,454km	VIN #	6FMT14H83JD809789
Registration Expiry Date	23/01/2025	Vehicle Colour	White

Cross out those items not applicable.

Tick for Pass Cross for Fail

Item	Pass	N/A	Fail
Identification			
1 Registration Plates Affixed and Legible	☒	☐	☐
2 Compliance Plate Affixed	☒	☐	☐
Lights / Electrical			
3 Park / Tail / Number Plate / Clearance	☒	☐	☐
4 Head Lights / Auxiliary Lights	☒	☐	☐
5 Brake Lights	☒	☐	☐
6 Reflectors / Lenses	☒	☐	☐
7 Warning Device / Turning Indicators	☒	☐	☐
8 Wipers / Washers	☒	☐	☐
Glazing			
9 Material / Visibility	☒	☐	☐
10 Window Operation	☒	☐	☐
Seats / Seat Belts			
11 Mountings / Construction	☒	☐	☐
12 Fitting / Operation / Condition	☒	☐	☐
Wheels & Tyres			
13 Wheels / Security	☒	☐	☐
14 Wheel Bearings	☒	☐	☐
15 Tyres Tread Depth & Condition	☒	☐	☐
Body / Fittings/ Protrusions			
16 Corrosion / Security / Damage	☒	☐	☐
17 Door / Bonnet / Catches	☒	☐	☐
18 Rear Vision Mirrors	☒	☐	☐
19 Rear Marker Plates	☒	☐	☐
20 Body Fittings / Bumper Bars	☒	☐	☐
Tow Couplings			
21 Auto Tow Couplings	☐	☒	☐
22 King Pin / Skid Plate	☒	☐	☐
23 Tow Eye / Drawbar / Safety Chains	☐	☒	☐
24 Ball Race Turn Table	☐	☒	☐
25 Goose Neck	☐	☒	☐

Tick for Pass Cross for Fail

Item	Pass	N/A	Fail
Braking			
26 Brake Components	☒	☐	☐
27 Brake Operation(Refer Notes)	☒	☐	☐
Steering			
28 Steering Box / Pitman Arm	☒	☐	☐
29 Arms / Linkages / Wheel	☒	☐	☐
30 King Pins	☒	☐	☐
31 Free Play	☒	☐	☐
Suspension			
32 Springs	☒	☐	☐
33 Hangers / Pins / Bushes	☒	☐	☐
34 Air Bags / Air Suspension	☒	☐	☐
35 Shock Absorbers	☒	☐	☐
36 Axles / Cross Members	☒	☐	☐
Oil / Fuel Leaks			
37 Engine / Driveline	☒	☐	☐
38 Steering / Accessories	☒	☐	☐
Exhaust			
39 Leaks / Design / Security	☒	☐	☐
40 Emissions	☒	☐	☐
Mountings			
41 Engine / Transmission	☒	☐	☐
42 Body	☒	☐	☐
Air Systems			
43 Leaks / Low Air Warning / Contamination	☒	☐	☐
44 Breakaway Protection	☒	☐	☐
Under body / Chassis			
45 Cracks / Security	☒	☐	☐
46 Corrosion	☒	☐	☐
Mudguards / Mud Flaps			
47 Fitted as Required	☒	☐	☐

Notes:

1. If manufacture specifications are unknown refer to the Heavy Vehicle Inspection Manual for minimum requirements.
2. For a heavy vehicle built after 1930, the service brake must bring the vehicle or combination to a stop within 16.5m from a speed of 35km/h.
3. Trailer breakaway protection must be checked for operation.

Name: Andrew Brandt

Signature: 



**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3235

Day: Monday Date: 21/10/2024

**MCKENNA GROUP
PTY LTD**

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. Mck74	Klms: 187,454km	Hours: N/A
----------------------------------	--------------	--------------------	-----------------	------------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)	☒
Check Fault Repair Log and carry out necessary repairs.	☒
Grease all lubrication points.	☒
Lift cab/boom, grease pivots, check condition and tension of belts.	☒
Check power steering for fluid levels and leaks.	☒
Check/top up engine oil and coolant level.	☒
Check transmission and differential for fluid levels and leaks.	☒
Check driveline and universal joints.	☒
Check all lights and reflectors.	☒
Check horn, instruments, gauges, wipers and washers.	☒
Check battery terminals and security.	☒
Inspect brake lining wear/travel and adjust if required.	☒

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.	
Inspect brake lining wear/travel and adjust if required.	
Check all lights and reflectors.	
Check condition of air lines and electrical cable.	
Inspect wheel nuts and wheels for security, tyres for tread and inflation.	
Change oil in oil filled wheel bearings and check other wheel bearings.	

Notes:

☒ B SERVICE CHECKLIST Including Items from Checklist A

☒ TRUCK (Approx 20,000km)

All components of "A" Service.	☒	Check wear/movement in pinion arm, drag arm, tie rods and spring shackles.	☒
Change engine oil and filters.	☒	Replace or clean air cleaner as required.	☒
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and max system.	☒
Test coolant and change water filters if required.	☒		
Check battery electrolyte level, terminals and security.	☒		
Check clutch linkage, clutch brake operation and adjustment.	☒		
Check front steering hub oil level.	☒		

☒ C SERVICE CHECKLIST Including Items from Checklist A and B

☒ TRUCK (Approx 200,000kms or annually)

All components of "A" and "B" Services.	☒	Change PTO Hydraulic filters.	☒
Change power steering oil and filter.	☒	Service air dryers where applicable.	☒
Change transmission oil and filter (300,000km for Synthetic Oil).	☒	Re-torque all "U" bolts and cross members.	☒
Change differential oil and filter.	☒		
Change oil in oil filled wheel bearings and check other wheel bearings.	☒		
Check clutch linkage, clutch brake operation and adjustment.	☒		

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *Andrew Brandt*

Date: 21/10/2024

OFFICE USE ONLY Entered By: *Amanda Smith*

Name:

Signature: *Amanda Smith*

Date: 22.10.24



**BRENDAN MCKENNA
EARTHMOVING**

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

MCKENNA HAULAGE

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

SERVICE REPORT

No. S 3206

Day: Tuesday Date: 02/07/2024

MCKENNA GROUP
PTY LTD

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. Mck74	Klms: 176,442km	Hours:
----------------------------------	--------------	--------------------	-----------------	--------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)	☒	☒	☒
Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and maxi).	☒
Grease all lubrication points.	☒	Drain condensation from air tanks.	☒
Lift cab/bornet, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.	☒
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.	☒
Check/top up engine oil and coolant level.	☒	Visual check of airbag suspension where fitted.	☒
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.	☒
Check driveline and universal joints.	☒	Check number plates, all labels for due date condition and security.	☒
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.	☒
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (If Applicable)	
Check battery terminals and security.	☒		
Inspect brake lining wear/travel and adjust if required.	☒		

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.	
Inspect brake lining wear/travel and adjust if required.		Visual check of airbag suspension where fitted.	
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.	
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.	
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (If Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			

Notes:

☒ B SERVICE CHECKLIST Including items from Checklist A

☒ TRUCK (Approx 20,000km)	☒	☒	☒
All components of "A" Service.	☒	Check wear/movement in pitman arm, drag arm, tie rods and spring shackles.	☒
Change engine oil and filters.	☒	Replace or clean air cleaner as required.	☒
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and maxi system.	☒
Test coolant and change water filters if required.	☒		
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (If Applicable)	
Check clutch linkage, clutch brake operation and adjustment.	☒		
Check front steering hub oil level.	☒		

☐ C SERVICE CHECKLIST Including items from Checklist A and B

☐ TRUCK (Approx 200,000kms or annually)

All components of "A" and "B" Services.		Change PTO Hydraulic filters.	
Change power steering oil and filter.		Service air dryers where applicable.	
Change transmission oil and filter (300,000km for Synthetic Oil).		Re-torque all "U" bolts and cross members.	
Change differential oil and filter.		Fault #/s Rectified (If Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			
Check clutch linkage, clutch brake operation and adjustment.			

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *Andrew Brandt*

Date: 02/07/2024

OFFICE USE ONLY Entered By:

Name:

Signature: *Amelia Smith*

Date: 2, 7, 24.

All Coast Tyre Solutions - Gympie

50/56 Mellor Street

Gympie QLD 4570

Ph: (07) 5482 6633

Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions

ABN: 18 718 867 756



Tax Invoice G019367

Date: 18 Jun 24

Customer: BRENDANMCKENNAEARTHMOVING

Terms: 30 Days from Statement

BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT

EATONS HILL QLD 4037

Written By: Craig Mattingley
Salesperson: GSC

Contact: Brendan

Mobile: 0417 710 806

Home Ph:

Bus Ph:

Fax:

Email: accounts@mckgroup.com.au

Deliver To: SAME

Odometer In: 174796

Out: 174796

Customer PO#:

Vehicle Details: MCKDOG 18 MACK SUPERLINER PRIME MOVER MCKDOG UNIT# MCK74

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
GO11225EZ373	GOODRIDE GOODRIDE 11R22.5 EZ373 16PR 148/145J DRIVE MIXED O	2	427.27	470.00	940.00
AS_6549997	Fitting - Truck Tyre Steel wheel POS 9 10	2	27.27	30.00	60.00
XX_0053702	Disposal of Casing - Truck Tyre	2	27.27	30.00	60.00

Payment Method: OnAccount=1060.00

BANK DETAILS

Account Name ALL COAST TYRE SOLUTIONS

BSB: 064014

Account No. 10040117

Please include your CUSTOMER ID as your Ref.

18/6 AL

Total includes GST of 96.35

Totals Items 2

Total \$ 1060.00

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:
Warranty provisions Customer Service Standards Quality Management Systems Customer Complaints System
If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:

Completed: 18 Jun 24 1:15 PM

Last Printed: 1:15 PM

Page: 1

All Coast Tyre Solutions - Gympie

50/56 Mellor Street

Gympie QLD 4570

Ph: (07) 5482 6633

Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions

ABN: 18 718 867 756



Tax Invoice G019305

Date: 13 Jun 24

Customer: BRENDANMCKENNAEARTHMOVING

Terms: 30 Days from Statement

BRENDAN MCKENNA EARTHMOVING
11 MONTEGO COURT

EATONS HILL QLD 4037

Written By: Dean Longman
Salesperson:

Contact: Brendan

Deliver To: SAME

Mobile: 0417 710 806

Home Ph:

Bus Ph:

Fax:

Email: accounts@mckgroup.com.au

Odometer

In: 0

Out: 0

Customer PO#: BERGS

Vehicle Details: MCKDOG

18 MACK SUPERLINER PRIME MOVER MCKDOG UNIT# MCK74

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
GO11225CR926D	GOODRIDE GOODRIDE 11R22.5 CR926D 16PR 148/145M ALL REGION(C	1	387.27	426.00	426.00
AS_6549997	Fitting - Truck Tyre Steel wheel	1	27.27	30.00	30.00
XX_0053702	Disposal of Casing - Truck Tyre	1	27.27	30.00	30.00

RIMS BOUGHT IN BY BERGS 13/6/24

Payment Method: OnAccount=486.00

BANK DETAILS

Account Name ALL COAST TYRE SOLUTIONS

BSB: 064014

Account No. 10040117

Please include your CUSTOMER ID as your Ref.

Total includes GST of 44.19

Totals Items 1

Total \$ 486.00

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:

Warranty provisions

Customer Service Standards

Quality Management Systems

Customer Complaints System

If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:

All Coast Tyre Solutions - Gympie

50/56 Mellor Street
Gympie QLD 4570
Ph: (07) 5482 6633
Fax:

E-mail: gympie@allcoasttyres.com.au
Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions
ABN: 18 718 867 756



Tax Invoice G019269

Date: 12 Jun 24

Customer: BRENDANMCKENNAEARTHMOVING

Terms: 30 Days from Statement

BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT

EATONS HILL QLD 4037

Written By: Peter O'Leary
Salesperson:

Deliver To: SAME

Contact: Brendan
Mobile: 0417 710 806 Home Ph:
Bus Ph: Fax:
Email: accounts@mckgroup.com.au
Odometer In: 173170 Out: 173170

Customer PO#: MCKDOG

Vehicle Details: MCKDOG 18 MACK SUPERLINER PRIME MOVER MCKDOG UNIT# MCK74

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
OGR1122516AG828	OGREEN 11R22.5 16PR 148/145 M AG828	2	390.00	429.00	858.00
AS_6459998	DRIVING Service Call - Business Hours (Per Hour)	2	132.72	146.00	292.00
AS_6549997	Fitting - Truck Tyre Steel wheel	2	27.27	30.00	60.00
XX_0053702	Disposal of Casing - Truck Tyre 1 rim brought back with gene punctured // tyre no good has a piece of wood and sidewall damage	2	27.27	30.00	60.00

Payment Method: OnAccount=1270.00

BANK DETAILS

Account Name ALL COAST TYRE SOLUTIONS

BSB: 064014

Account No. 10040117

Please include your CUSTOMER ID as your Ref.

Total includes GST of 115.45

Totals Items 2

Total \$ 1270.00

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:
Warranty provisions Customer Service Standards Quality Management Systems Customer Complaints System
If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.


Received by:

Date:

Completed: 12 Jun 24 4:03 PM

Last Printed: 4:03 PM

Page: 1

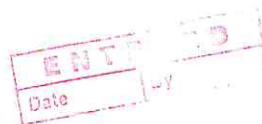

1 / 10 Lear Jet Drive
Caboolture Queensland 4510
ABN: 85660980414
Tel: 07 5499 1049
Fax: 07 5499 3643
Email: sales@ttaa.com.au
Website:
www.totaltyresandauto.com.au



TAX INVOICE

Tax Invoice Number: TTA - INV104393
Date: 11/03/2024
Due Date: 30/04/2024


BILL TO:

Brendan McKenna Earthmoving Pty-Ltd
11 Montego Court
Eatons Hill Queensland 4037
ABN: 94 163 887 563
Tel: Angela - 0418717154
Email: angela@mckgroup.com.au

FOR:

Model: MACK SUPERLINER
Reg No: MCKDOG
Body Type: PRIME MOVER
Year: 2018

Description	Qty.	Unit Price	GST	Amount
ONSITETRWRKHOURS - ONSITE-CALLOUT TRUCK WORK HOURS	1.0	\$99.00	\$9.00	\$99.00
GC11225AD156 - Golden Crown 11R22.5 AD156 16PR Drive 148/145M	1.0	\$399.00	\$36.27	\$399.00
TYREDISPOSAL-TB - Tyre Disposal - Truck Bus Tyre Disposal - Truck / Bus	1.0	\$27.50	\$2.50	\$27.50

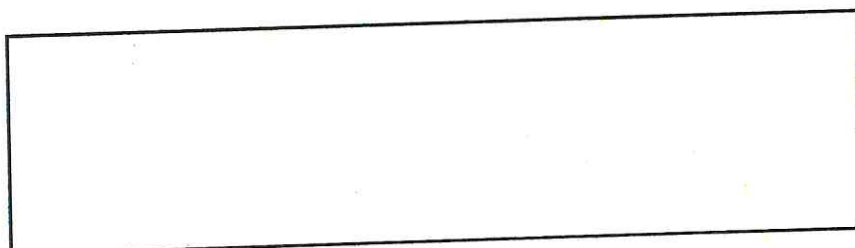

Subtotal	\$477.73
GST	\$47.77
Total	\$525.50
Paid	\$0.00
Balance Due	\$525.50

Direct Deposit

BSB: 014309
ACC: 433109765

Please use your invoice number as your payment reference when paying via Direct deposit bank transfer. Thank-you for your business.

The Tyre Product Stewardship Scheme is a government supported scheme focused on responsible tyre disposal, and the sustainable management of end-of-life tyres. We have been an active member of the scheme since January 2023. Together, we aim to change the way end-of-life tyres are managed and make our industry more environmentally sustainable.



MCKENNA GROUP
PTY LTD

BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5601
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S3176

Day: Tuesday Date: 09/01/2024

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. Mck74	Klms: 155,513km	Hours: N/A
----------------------------------	--------------	--------------------	-----------------	------------

☐ **A SERVICE CHECKLIST**

☒ **TRUCK (Approx 10,000km - 12,000km)**

Check Fault Repair Log and carry out necessary repairs.	Check brake system for leaks (service and max).
Grease all lubrication points.	Drain condensation from air tanks.
Lift cab/boom, grease pivots, check condition and tension of belts.	Check steering joints and linkages.
Check power steering for fluid levels and leaks.	Inspect for any obvious faults in suspension, structure or bodywork.
Check/top up engine oil and coolant level.	Visual check of airbag suspension where fitted.
Check transmission and differential for fluid levels and leaks.	Inspect wheel nuts and wheels for security.
Check driveline and universal joints.	Tyres for tread and inflation.
Check all lights and reflectors.	Check number plates, all labels for due date condition and security.
Check horn, instruments, gauges, wipers and washers.	Check for visible exhaust emissions and lack of engine power.
Check battery terminals and security.	Fault #/s Rectified (If Applicable)
Inspect brake lining wear/travel and adjust if required.	

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.	Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/travel and adjust if required.	Visual check of airbag suspension where fitted.
Check all lights and reflectors.	Check number plate, and all labels due date, condition and security.
Check condition of air lines and electrical cable.	Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security.	Fault #/s Rectified (If Applicable)
Tyres for tread and inflation.	
Change oil in oil filled wheel bearings and check other wheel bearings.	

Notes:

☐ **B SERVICE CHECKLIST Including items from Checklist A**

☒ **TRUCK (Approx 20,000km)**

All components of "A" Service.	Check wear/movement in pitman arm, drag arm, tie rods and upper shackles.
Change engine oil and filter.	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	Check trailer breakaway and mast system.
Test coolant and change water filters if required.	
Check battery electrolyte level, terminals and security.	Fault #/s Rectified (If Applicable)
Check clutch linkage, clutch brake operation and adjustment.	
Check front steering hub oil level.	

☐ **C SERVICE CHECKLIST Including items from Checklist A and B**

☐ **TRUCK (Approx 200,000kms or annually)**

All components of "A" and "B" Services.	Change PTO hydraulic filters.
Change power steering oil and filter.	Service air dryers where applicable.
Change transmission oil and filter (300,000km for Synthetic Oil).	Re-torque all "U" bolts and cross members.
Change differential oil and filter.	Fault #/s Rectified (If Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	Replace faulty battery isolator switch
Check clutch linkage, clutch brake operation and adjustment.	

The person completing the service is to print their name and sign.

Name: Andrew Brandt
Signature: *Andrew Brandt*

OFFICE USE ONLY Entered By: *Amelinda Smith*
Name: *Amelinda Smith*
Signature: *Amelinda Smith*
Date: 17.1.24

Date: 09/01/2024

Heavy Vehicle Inspection Checklist

This checklist is used to complete a vehicle inspection that meets maintenance management standard 4 criteria(4). The inspection must be completed or supervised by a suitably qualified person whose name and signature must appear on the form.

Registration # MCKDOG
Reason for Inspection Annual Inspection
Inspection Date 24/10/2023
Inspection Time 3pm
Odometer 149,580Km
Registration Expiry Date 23/01/2024

Owner's Details
Inspection Location Toolara
Make Mack
Model Superliner
VIN # 6FMT14H83JD809789
Vehicle Colour White

Cross out those items not applicable.

Tick for Pass Cross for Fail

Item	Pass	N/a	Fail
Identification			
1 Registration Plates Affixed and Legible	☒	☐	☐
2 Compliance Plate Affixed	☒	☐	☐
Lights / Electrical			
3 Park / Tail / Number Plate / Clearance	☒	☐	☐
4 Head Lights / Auxiliary Lights	☒	☐	☐
5 Brake Lights	☒	☐	☐
6 Reflectors / Lenses	☒	☐	☐
7 Warning Device / Turning Indicators	☒	☐	☐
8 Wipers / Washers	☒	☐	☐
Glazing			
9 Material / Visibility	☒	☐	☐
10 Window Operation	☒	☐	☐
Seats / Seat Belts			
11 Mountings / Construction	☒	☐	☐
12 Fitting / Operation / Condition	☒	☐	☐
Wheels & Tyres			
13 Wheels / Security	☒	☐	☐
14 Wheel Bearings	☒	☐	☐
15 Tyres Tread Depth & Condition	☒	☐	☐
Body / Fittings/ Protrusions			
16 Corrosion / Security / Damage	☒	☐	☐
17 Door / Bonnet / Catches	☒	☐	☐
18 Rear Vision Mirrors	☒	☐	☐
19 Rear Marker Plates	☒	☐	☐
20 Body Fittings / Bumper Bars	☒	☐	☐
Tow Couplings			
21 Auto Tow Couplings	☒	☐	☐
22 King Pin / Skid Plate	☐	☒	☐
23 Tow Eye / Drawbar / Safety Chains	☐	☒	☐
24 Ball Race Turn Table	☒	☐	☐
25 Goose Neck	☐	☒	☐

Tick for Pass Cross for Fail

Item	Pass	N/a	Fail
Braking			
26 Brake Components	☒	☐	☐
27 Brake Operation (Refer Notes)	☒	☐	☐
Steering			
28 Steering Box / Pitman Arm	☒	☐	☐
29 Arms / Linkages / Wheel	☒	☐	☐
30 King Pins	☒	☐	☐
31 Free Play	☒	☐	☐
Suspension			
32 Springs	☒	☐	☐
33 Hangers / Pins / Bushes	☒	☐	☐
34 Air Bags / Air Suspension	☒	☐	☐
35 Shock Absorbers	☒	☐	☐
36 Axles / Cross Members	☒	☐	☐
Oil / Fuel Leaks			
37 Engine / Driveline	☒	☐	☐
38 Steering / Accessories	☒	☐	☐
Exhaust			
39 Leaks / Design / Security	☒	☐	☐
40 Emissions	☒	☐	☐
Mountings			
41 Engine / Transmission	☒	☐	☐
42 Body	☒	☐	☐
Air Systems			
43 Leaks / Low Air Warning / Contamination	☒	☐	☐
44 Breakaway Protection	☒	☐	☐
Under body / Chassis			
45 Cracks / Security	☒	☐	☐
46 Corrosion	☒	☐	☐
Mudguards / Mud Flaps			
47 Fitted as Required	☒	☐	☐

Notes:

1. If manufacture specifications are unknown refer to the Heavy Vehicle Inspection Manual for minimum requirements.
2. For a heavy vehicle built after 1930, the service brake must bring the vehicle or combination to a stop within 16.5m from a speed of 35km/h.
3. Trailer breakaway protection must be checked for operation.

Name: Andrew Brandt

Signature: Andrew Brandt



MCKENNA GROUP
PTY LTD

**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S3171

Day: Tuesday Date: 24/10/2023

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. Mck74	Klms: 149,580Km	Hours: 3116Hrs
----------------------------------	--------------	--------------------	-----------------	----------------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)	☒	☒
Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and mast).
Grease all lubrication points.	☒	Drain condensation from air tanks.
Lift cab/boom, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.
Check/hop up engine oil and coolant level.	☒	Visual check of airbag suspension where fitted.
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.
Check drive-line and universal joints.	☒	Check number plates, all labels for due date expiration and security.
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)
Check battery terminals and security.	☒	
Inspect brake lining wear/travel and adjust if required.	☒	

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/travel and adjust if required.		Visual check of airbag suspension where fitted.
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.		

Notes:

☒ B SERVICE CHECKLIST Including items from Checklist A

☒ TRUCK (Approx 20,000km)	☒	☒
All components of "A" service.	☒	Check wear/movement in pitman arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	☒	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and mast system.
Test coolant and change water filters if required.	☒	
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (if Applicable)
Check clutch linkage, clutch brake operation and adjustment.	☒	
Check front steering hub oil level.	☒	

☒ C SERVICE CHECKLIST Including items from Checklist A and B

☒ TRUCK (Approx 200,000kms or annually)	☒	☒
All components of "A" and "B" services.	☒	Change PTO Hydraulic filters.
Change power steering oil and filter.	☒	Service air dryers where applicable.
Change transmission oil and filter (300,000km for Synthetic Oil).	☒	Re-torque all "U" bolts and cross members.
Change differential oil and filter.	☒	Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	☒	
Check clutch linkage, clutch brake operation and adjustment.	☒	

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *Andrew Brandt*

Date: 24/10/2023

OFFICE USE ONLY Entered By: *Amanda Smith*

Name: *Amanda Smith*

Signature: *Amanda Smith*

Date: 26/10/23

All Coast Tyre Solutions - Gympie

50/56 Mellor Street
Gympie QLD 4570
Ph: (07) 5482 6633

Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions

ABN: 18 718 867 756



Tax Invoice G015225

Date: 25 Oct 23

Customer: BRENDANMCKENNAEARTHMOVING
BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT
EATONS HILL QLD 4037

Terms: 30 Days from Statement

Written By: Tom Ryan
Salesperson:

Deliver To: SAME

Contact: Brendan
Mobile: 0417 710 806 Home Ph:
Bus Ph: Fax:
Email: accounts@mckgroup.com.au
Odometer In: 123456 Out: 123456
Vehicle Details: MCKDOG 18 MACK SUPERLINER PRIME MOVER MCKDOG UNIT# MCK74

Customer PO#:

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
586530	OGREEN 11R22.5 148/145M AG828	2	390.00	429.00	858.00
AS_6549989	Fit Truck Tyre - Alloy Wheel	2	22.72	25.00	50.00
	Pos 3-4				
XX_0053702	Disposal of Casing - Truck Tyre	2	20.00	22.00	44.00
AS_6459998	Roadside Service - Time Business Hours (1 hour)	2	115.00	126.50	253.00

Truck Tyre Fitment
Technician Comments
-- Also asked to do pressure in Trailer I put 95psi as asked
Subtotals Tax out 0.00 Tax in 0.00

Payment Method: OnAccount=1205.00

BANK DETAILS

Account Name ALL COAST TYRE SOLUTIONS

BSB: 064014

Account No. 10040117

Please include your CUSTOMER ID as your Ref.

Total includes GST of 109.55

Totals Items 2

Total \$ 1205.00

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:
Warranty provisions Customer Service Standards Quality Management Systems Customer Complaints System
If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:

Completed: 25 Oct 23 5:16 PM

Last Printed: 5:16 PM

Page: 1

All Coast Tyre Solutions - Gympie

50/56 Mellor Street

Gympie QLD 4570

Ph: (07) 5482 6633

Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions

ABN: 18 718 867 756



DUNLOP
SUPER DEALER

Tax Invoice G014372

Date: 06 Sep 23

Customer: BRENDANMCKENNAEARTHMOVING

Terms: 30 Days from Statement

BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT

EATONS HILL QLD 4037

Written By: Craig Mattingley
Salesperson:

Deliver To: SAME

Contact: Brendan

Mobile: 0417 710 806

Home Ph:

Bus Ph:

Fax:

Email: accounts@mckgroup.com.au

Odometer In: 1

Out: 1

Customer PO#:

Vehicle Details: MCKDOG

18 MACK SUPERLINER PRIME MOVER MCKDOG UNIT# MCK74

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
586530	TRUCK LOCKED NO KM'S	2	390.00	429.00	858.00
AS_6549989	OGREEN 11R22.5 148/145M AG828	2	22.72	25.00	50.00
	Fit Truck Tyre - Alloy Wheel				
	Pos 5-6				
XX_0053702	Disposal of Casing - Truck Tyre	2	20.00	22.00	44.00
AS_6489905	SERVICE CALL BUSINESS HOURS (PER HOUR)	2	115.00	126.50	253.00
	TOOLARA FORESTRY OFFICE				
	Truck Tyre Fitment				
	OK				
	-- Tyre Fitment: Comments				
	-- fitted 2x 11r225 ogreen 828s to pos 5,6 on prime mover at depot.				
	Subtotals Tax out 0.00 Tax in 0.00				
	Technician Comments				
	Subtotals Tax out 0.00 Tax in 0.00				

Service Call

Payment Method: OnAccount=1205.00

Total includes GST of

Totals Items

Total \$

Cont'd

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:
Warranty provisions Customer Service Standards Quality Management Systems Customer Complaints System
If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:

Last Printed: 7:19 PM

Page: 1

Completed: 13 Sep 23 7:13 PM

All Coast Tyre Solutions - Gympie

50/56 Mellor Street
Gympie QLD 4570
Ph: (07) 5482 6633
Fax:

E-mail: gympie@allcoasttyres.com.au

Jaxport Pty Ltd ATF Yandina Unit Trust - All Coast Tyre Solutions
ABN: 18 718 867 756



DUNLOP
SUPER DEALER

Tax Invoice G012079

Date: 04 May 23

Customer: BRENDANMCKENNAEARTHMOVING
BRENDAN McKENNA EARTHMOVING
11 MONTEGO COURT
EATONS HILL QLD 4037

Terms: 30 Days from Statement

Written By: Craig Mattingley
Salesperson:

Deliver To: SAME

Contact: Brendan
Mobile: 0417710806 Home Ph:
Bus Ph: Fax:
Email: accounts@mckgroup.com.au

Customer PO#:

Odometer In: 133604 Out: 133604
Vehicle Details: MCKDOG 18 MACK SUPERLINER PRIME MOVER MCKDOG

Item	Description	QTY	Unit Price (Excl GST)	Unit Price (Incl GST)	Total (Incl GST)
263242TEST	MICHELIN 295/80R22.5 TEST X MULTI Z 2 TL	2	550.00	605.00	1210.00
AS_6549989	154/150L VM	2	22.72	25.00	50.00
XX_0053702	Fit Truck Tyre - Alloy Wheel	2	20.00	22.00	44.00
AS_6489905	Disposal of Casing - Truck Tyre	1	115.00	126.50	126.50
	SERVICE CALL BUSINESS HOURS (PER HOUR)				

Truck Tyre Fitment
Service Call

Payment Method: OnAccount=1430.50

BANK DETAILS
Account Name ALL COAST TYRE SOLUTIONS
BSB: 064014
Account No. 10040117
Please include your CUSTOMER ID as your Ref.

Total includes GST of 130.05 Totals Items 2 Total \$ 1430.50

Customer Service Policy: As we are committed to making our customer feel important, we have procedures in place to insure that we achieve this goal including:
Warranty provisions Customer Service Standards Quality Management Systems Customer Complaints System
If you require further information or if you are dissatisfied for any reason, please speak to your local store manager, or phone the Customer Service Manager on 1800 809 625 or write to the Customer Service Manager P.O. Box 479, Carlton South Vic. 3053.

Terms and Conditions of Trade: These goods are sold in accordance with Tyre Marketers (Australia) Limited's terms and conditions of sale (02/01). All payments are to be made in full, without any deduction of any nature, including by way of set-off. Property in products shall not pass until payment in full in cleared funds of all monies monies owed for those products or any other basis. Acceptance of these goods implies acceptance of such conditions.

Received by:

Date:

Last Printed: 7:52 PM

Page: 1

Completed: 09 May 23 7:52 PM



BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3133
Day: Wednesday Date: 22/03/2023

MCKENNA GROUP
PTY LTD

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Klms: 129,488	Hours:
----------------------------------	--------------	--------------------	---------------	--------

☒ **A SERVICE CHECKLIST**

☒ TRUCK (Approx 10,000km - 12,000km)	☒	☒
Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and max).
Grease all lubrication points.	☒	Drain condensation from air tanks.
Lift cab/hornet, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.
Check/top up engine oil and coolant level.	☒	Visual check of airbag suspension wheels fitted.
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.
Check driveline and universal joints.	☒	Check number plates, all labels for due date condition and security.
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)
Check battery terminals and security.	☒	
Inspect brake lining wear/fluid and adjust if required.	☒	

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/fluid and adjust if required.		Visual check of airbag suspension where fitted.
Check all lights and reflectors.		Check number plates and all labels due date, condition and security.
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.		

Notes:

Replaced Air dryer filter, Found hole in exhaust y piece ordered.

☒ **B SERVICE CHECKLIST Including items from Checklist A**

☒ TRUCK (Approx 20,000km)	☒	☒
All components of "X" service.	☒	Check wear/movement in pinion arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	☒	Replace or clean air cleaner as required.
Change fuel filter and bleed and check for leaks.	☒	Check trailer breakaway and max system.
Test coolant and change water filter if required.	☒	
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (if Applicable)
Check clutch linkages, clutch brake operation and adjustment.	☒	
Check front steering hub oil level.	☒	

☐ **C SERVICE CHECKLIST Including items from Checklist A and B**

☐ TRUCK (Approx 200,000kms or annually)		
All components of "X" and "B" services.		Change PTO Hydraulics filters.
Change power steering oil and filter.		Service air dryers where applicable.
Change transmission oil and filter (300,000kms for Synthetic Oil).		Re-torque all "U" bolts and cross members.
Change differential oil and filter.		Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.		
Check clutch linkages, clutch brake operation and adjustment.		

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *A Brandt*

OFFICE USE ONLY Entered By: *Amarda Smith*

Name:

Signature: *Amarda Smith*

Date: 22/03/2023

Date: 23.4.23



**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 14037
ABN 35 108 043 312

SERVICE REPORT No. S3116

Day: Saturday Date: 15/10/2022

MCKENNA GROUP
PTY LTD

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Kilms: 107592	Hours:
----------------------------------	--------------	--------------------	---------------	--------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)

Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and max).	☒
Grease all lubrication points.	☒	Drain condensation from air tanks.	☒
Lift cab/hornet, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.	☒
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.	☒
Check/top up engine oil and coolant level.	☒	Visual check of airbag suspension where fitted.	☒
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyre for tread and inflation.	☒
Check drive/line and universal joints.	☒	Check number plates, all labels for due date condition and security.	☒
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.	☒
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)	☒
Check battery terminals and security.	☒		
Inspect brake lining wear/thickness and adjust if required.	☒		

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.	
Inspect brake lining wear/thickness and adjust if required.		Visual check of airbag suspension where fitted.	
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.	
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.	
Inspect wheel nuts and wheels for security, tyre for tread and inflation.		Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			

Notes:

☒ B SERVICE CHECKLIST Including items from Checklist A

☒ TRUCK (Approx 20,000km)

All components of "A" Service.	☒	Check wear/movement in pinman arm, drag arm, tie rods and spring shackles.	☒
Change engine oil and filters.	☒	Replace or clean air cleaner as required.	☒
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and mast system.	☒
Test coolant and change water filters if required.	☒		
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (if Applicable)	
Check clutch linkage, clutch brake operation and adjustment.	☒		
Check front steering hub oil level.	☒		

☒ C SERVICE CHECKLIST Including items from Checklist A and B

☒ TRUCK (Approx 200,000kms or annually)

All components of "A" and "B" Services.	☒	Change PTO hydraulic filters.	☒
Change power steering oil and filter.	☒	Service air dryer where applicable.	☒
Change transmission oil and filter (recommend for Synthetic Oil).	☒	Re-torque all "U" bolts and cross members.	☒
Change differential oil and filter.	☒	Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.	☒		
Check clutch linkage, clutch brake operation and adjustment.	☒		

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature:

Date: 15/10/2022

OFFICE USE ONLY Entered By:

Name:

Signature:

Date: 20, 10, 2022

Heavy Vehicle Inspection Checklist

This checklist is used to complete a vehicle inspection that meets maintenance management standard 4 criteria(4). The inspection must be completed or supervised by a suitably qualified person whose name and signature must appear on the form.

Registration #	MCKDOG	Owner's Details	
Reason for Inspection	Annual	Inspection location	Toolara
Inspection Date	15/10/2022	Make	Mack
Inspection Time	11am	Model	Superliner
Odometer	107,592km	VIN #	6FMT14H83JD809789
Registration Expiry Date		Vehicle Colour	White/Black

Cross out those items not applicable.

Tick for Pass Cross for Fail

Tick for Pass Cross for Fail

Item	Pass	N/A	Fail
Identification			
1 Registration Plates Affixed and Legible	☒	☐	☐
2 Compliance Plate Affixed	☒	☐	☐
Lights / Electrical			
3 Park / Tail / Number Plate / Clearance	☒	☐	☐
4 Head Lights / Auxiliary Lights	☒	☐	☐
5 Brake Lights	☒	☐	☐
6 Reflectors / Lenses	☒	☐	☐
7 Warning Device / Turning Indicators	☒	☐	☐
8 Wipers / Washers	☒	☐	☐
Glazing			
9 Material / Visibility	☒	☐	☐
10 Window Operation	☒	☐	☐
Seats / Seat Belts			
11 Mountings / Construction	☒	☐	☐
12 Fitting / Operation / Condition	☒	☐	☐
Wheels & Tyres			
13 Wheels / Security	☒	☐	☐
14 Wheel Bearings	☒	☐	☐
15 Tyres Tread Depth & Condition	☒	☐	☐
Body / Fittings/ Protrusions			
16 Corrosion / Security / Damage	☒	☐	☐
17 Door / Bonnet / Catches	☒	☐	☐
18 Rear Vision Mirrors	☒	☐	☐
19 Rear Marker Plates	☒	☐	☐
20 Body Fittings / Bumper Bars	☒	☐	☐
Tow Couplings			
21 Auto Tow Couplings	☐	☒	☐
22 King Pin / Skid Plate	☒	☐	☐
23 Tow Eye / Drawbar / Safety Chains	☐	☒	☐
24 Ball Race Turn Table	☐	☒	☐
25 Goose Neck	☐	☒	☐

Item	Pass	N/A	Fail
Braking			
26 Brake Components	☒	☐	☐
27 Brake Operation(Refer Notes)	☒	☐	☐
Steering			
28 Steering Box / Pitman Arm	☒	☐	☐
29 Arms / Linkages / Wheel	☒	☐	☐
30 King Pins	☒	☐	☐
31 Free Play	☒	☐	☐
Suspension			
32 Springs	☒	☐	☐
33 Hangers / Pins / Bushes	☒	☐	☐
34 Air Bags / Air Suspension	☒	☐	☐
35 Shock Absorbers	☒	☐	☐
36 Axles / Cross Members	☒	☐	☐
Oil / Fuel Leaks			
37 Engine / Driveline	☒	☐	☐
38 Steering / Accessories	☒	☐	☐
Exhaust			
39 Leaks / Design / Security	☒	☐	☐
40 Emissions	☒	☐	☐
Mountings			
41 Engine / Transmission	☒	☐	☐
42 Body	☒	☐	☐
Air Systems			
43 Leaks / Low Air Warning / Contamination	☒	☐	☐
44 Breakaway Protection	☒	☐	☐
Under body / Chassis			
45 Cracks / Security	☒	☐	☐
46 Corrosion	☒	☐	☐
Mudguards / Mud Flaps			
47 Fitted as Required	☒	☐	☐

Notes:

1. If manufacture specifications are unknown refer to the Heavy Vehicle Inspection Manual for minimum requirements.
2. For a heavy vehicle built after 1930, the service brake must bring the vehicle or combination to a stop within 16.5m from a speed of 35km/h.
3. Trailer breakaway protection must be checked for operation.

Name: Andrew Brandt

Signature: ABrandt



**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 14037
ABN 35 108 043 312

SERVICE REPORT No. S 3090
Day: Monday Date: 20/06/2022

**MCKENNA GROUP
PTY LTD**

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Kilms: 91600	Hours:
----------------------------------	--------------	--------------------	--------------	--------

☒ **A SERVICE CHECKLIST**

☒ TRUCK (Approx 10,000km - 12,000km)	☒ TRUCK (Approx 20,000km)	☒ TRUCK (Approx 20,000km)
Check fault/repair log and carry out necessary repairs.	✓	✓
Grease all lubrication points.	✓	✓
Lift cab/body/mast, grease pivots, check condition and tension of belts.	✓	✓
Check power steering for fluid levels and leaks.	✓	✓
Check/adjust up engine oil and coolant level.	✓	✓
Check transmission and differential for fluid levels and leaks.	✓	✓
Check drive/line and universal joints.	✓	✓
Check all lights and reflectors.	✓	✓
Check horn, instruments, gauges, wipers and wipers.	✓	✓
Check battery terminals and security.	✓	✓
Inspect/replace timing wear/level and adjust if required.	✓	✓

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.	✓
Inspect brake lining wear/level and adjust if required.	✓
Check all lights and reflectors.	✓
Check condition of air lines and electrical cable.	✓
Inspect wheel nuts and wheels for security, tyres for tread and inflation.	✓
Change with oil filled wheel bearings and check other wheel bearings.	✓

Notes:

☒ **B SERVICE CHECKLIST Including items from Checklist A**

☒ TRUCK (Approx 20,000km)	☒ TRUCK (Approx 20,000km)	☒ TRUCK (Approx 20,000km)
All components of "A" Service.	✓	✓
Change engine oil and filter.	✓	✓
Change fuel filters and bleed and check for leaks.	✓	✓
Test coolant and change water filters if required.	✓	✓
Check battery electrolyte level, terminals and security.	✓	✓
Check clutch linkage, clutch brake operation and adjustment.	✓	✓
Check front steering rule oil level.	✓	✓

☐ **C SERVICE CHECKLIST Including items from Checklist A and B**

☐ TRUCK (Approx 200,000kms or annually)	☐ TRUCK (Approx 200,000kms or annually)	☐ TRUCK (Approx 200,000kms or annually)
All components of "A" and "B" Service.	✓	✓
Change power steering oil and filter.	✓	✓
Change transmission oil and filter (300,000km for Synthetic Oil).	✓	✓
Change differential oil and filter.	✓	✓
Change oil in oil filled wheel bearings and check other wheel bearings.	✓	✓
Check clutch linkage, clutch brake operation and adjustment.	✓	✓

The person completing the service is to print their name and sign.

Name: Andrew Brandt
Signature: *Andrew Brandt*

Date: 20/06/2022

OFFICE USE ONLY Entered By:
Name: *Arrendia Smith*
Signature: *Arrendia Smith*
Date: *24.6.22*



BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

MCKENNA GROUP
PTY LTD

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3084

Day: Tuesday Date: 07/06/2022

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Kilms: 86,254km	Hours: N/A
☐ A SERVICE CHECKLIST				
☒ TRUCK (Approx 10,000km - 12,000km)				
Check Fault Repair Log and carry out necessary repairs.	Check brake system for leaks (service and main).			
Grease all lubrication points.	Drain condensation from air tanks.			
Left cab/bumper, grease points, check condition and tension of belts.	Check steering joints and linkages.			
Check power steering for fluid levels and leaks.	Inspect for any obvious faults in suspension, structure or bodywork.			
Check/top up engine oil and coolant level.	Visual check of airbag suspension where fitted.			
Check transmission and differential for fluid levels and leaks.	Inspect wheel nuts and wheels for security.			
	Tyres for tread and inflation.			
Check driveline and universal joints.	Check number plates, all labels for due date condition and security.			
Check all lights and reflectors.	Check for visible exhaust emissions and lack of engine power.			
Check horn, instruments, gauges, wipers and washers.	Fault #/s Rectified (if Applicable)			
Check battery terminals and security.				
Inspect brake lining wear/thickness and adjust if required.				
☐ TRAILER (Approx 6 monthly/annually)				
Grease all lubrication points.	Inspect for any obvious faults in suspension, structure or bodywork.			
Inspect brake lining wear/thickness and adjust if required.	Visual check of airbag suspension where fitted.			
Check all lights and reflectors.	Check number plates, and all labels due date, condition and security.			
Check condition of air lines and electrical cable.	Re-torque all "U" bolts and cross members.			
Inspect wheel nuts and wheels for security, tyres for tread and inflation.	Fault #/s Rectified (if Applicable)			
Change oil in oil filled wheel bearings and check other wheel bearings.				

☐ B SERVICE CHECKLIST Including Items from Checklist A	
☒ TRUCK (Approx 20,000km)	
All components of "X" Service.	Check wear/movement in piston arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	Check water breakaway and main system.
Test coolant and change water filters if required.	
Check battery electrolyte level, terminals and security.	
Check clutch linkage, clutch brake operation and adjustment.	Fault #/s Rectified (if Applicable)
Check front steering hub oil level.	

☐ C SERVICE CHECKLIST Including Items from Checklist A and B	
☒ TRUCK (Approx 200,000kms or annually)	
All components of "A" and "B" Services.	Change PTO Hydraulic filters.
Change power steering oil and filter.	Service air divers where applicable.
Change transmission oil and filter (300,000kms for Synthetic Oil).	Retorque all "U" bolts and cross members.
Change differential oil and filter.	Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	Replace right side exhaust elbow at bottom of stack, replace left side exhaust stack
Check clutch linkage, clutch brake operation and adjustment.	

Notes:

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: *A Brandt*

Date: 07/06/2022

OFFICE USE ONLY Entered By: *Angela Walker*

Name:

Signature: *Angela Walker*

Date: 17/6/22



BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3075

Day: Friday Date: 04/03/2022

MCKENNA GROUP
PTY LTD

Vehicle/Trailer: Mack Superliner	Rago: MCKDOG	MCK Unit No. MCK74	Klms: 79,616km	Hours: N/A
----------------------------------	--------------	--------------------	----------------	------------

☒ **A SERVICE CHECKLIST**

☒ **TRUCK (Approx 10,000km - 12,000km)**

Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and main).	☒
Grease all lubrication points.	☒	Drain condensation from air tanks.	☒
Lift cab/bonnet, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.	☒
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.	☒
Check/top up engine oil and coolant level.	☒	Visual check of airbag suspension where fitted.	☒
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.	☒
Check driveline and universal joints.	☒	Check number plates, all labels for due date condition and security.	☒
Check all lights and reflectors.	☒	Check for visible exhaust emissions and leak of engine power.	☒
Check horn, instrumentals, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)	☒
Check battery terminals and security.	☒		
Inspect brake lining wear/tear and adjust if required.	☒		

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.	
Inspect brake lining wear/tear and adjust if required.		Visual check of airbag suspension where fitted.	
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.	
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.	
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			

Notes:

☒ **B SERVICE CHECKLIST Including items from Checklist A**

☒ **TRUCK (Approx 20,000km)**

All components of "A" Service.	☒	Check wear/movement in pitman arm, drag arm, tie rods and spring shackles.	☒
Change engine oil and filters.	☒	Replace or clean air cleaner as required.	☒
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and mast system.	☒
Test coolant and change water filters if required.	☒		
Check battery electrolyte level, terminals and security and adjustment.	☒	Fault #/s Rectified (if Applicable)	
Check clutch linkage, clutch brake operation and adjustment.	☒		
Check front steering tube oil level.	☒		

☐ **C SERVICE CHECKLIST Including items from Checklist A and B**

☐ **TRUCK (Approx 200,000kms or annually)**

All components of "A" and "B" Services.		Change FTO Hydraulic filters.	
Change power steering oil and filter.		Service air dryers where applicable.	
Change transmission oil and filter (300,000kms for Synthetic Oil).		Re-torque all "U" bolts and cross members.	
Change differential oil and filter.		Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			
Check clutch linkage, clutch brake operation and adjustment.			

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature:

Date: 04/03/2022

OFFICE USE ONLY Entered By:

Name: A. McKenna

Signature:

Date: 01.3.22.

Heavy Vehicle Inspection Checklist

This checklist is used to complete a vehicle inspection that meets maintenance management standard 4 criteria(4). The inspection must be completed or supervised by a suitably qualified person whose name and signature must appear on the form.

Registration # **MCKDOG**
Reason for Inspection
Inspection Date **20/10/2021**
Inspection Time **9am**
Odometer **68046**
Registration Expiry Date **23-07-22**

Owner's Details
Inspection location **Red Road, Beerburrum**
Make **Mack**
Model **Superliner**
VIN # **6FMT14H83JD809789**
Vehicle Colour **White**

Cross out those items not applicable.

Tick for Pass Cross for Fail

Tick for Pass Cross for Fail

Item	Pass	N/a	Fail
Identification			
1 Registration Plates Affixed and Legible	☒	☐	☐
2 Compliance Plate Affixed	☒	☐	☐
Lights / Electrical			
3 Park / Tail / Number Plate / Clearance	☒	☐	☐
4 Head Lights / Auxiliary Lights	☒	☐	☐
5 Brake Lights	☒	☐	☐
6 Reflectors / Lenses	☒	☐	☐
7 Warning Device / Turning Indicators	☒	☐	☐
8 Wipers / Washers	☒	☐	☐
Glazing			
9 Material / Visibility	☒	☐	☐
10 Window Operation	☒	☐	☐
Seats / Seat Belts			
11 Mountings / Construction	☒	☐	☐
12 Fitting / Operation / Condition	☒	☐	☐
Wheels & Tyres			
13 Wheels / Security	☒	☐	☐
14 Wheel Bearings	☒	☐	☐
15 Tyres Tread Depth & Condition	☒	☐	☐
Body / Fittings/ Protrusions			
16 Corrosion / Security / Damage	☒	☐	☐
17 Door / Bonnet / Catches	☒	☐	☐
18 Rear Vision Mirrors	☒	☐	☐
19 Rear Marker Plates	☒	☐	☐
20 Body Fittings / Bumper Bars	☒	☐	☐
Tow Couplings			
21 Auto Tow Couplings	☐	☒	☐
22 King Pin / Skid Plate	☒	☐	☐
23 Tow Eye / Drawbar / Safety Chains	☐	☒	☐
24 Ball Race Turn Table	☐	☒	☐
25 Goose Neck	☐	☒	☐

Item	Pass	N/a	Fail
Braking			
26 Brake Components	☒	☐	☐
27 Brake Operation(Refer Notes)	☒	☐	☐
Steering			
28 Steering Box / Pitman Arm	☒	☐	☐
29 Arms / Linkages / Wheel	☒	☐	☐
30 King Pins	☒	☐	☐
31 Free Play	☒	☐	☐
Suspension			
32 Springs	☒	☐	☐
33 Hangers / Pins / Bushes	☒	☐	☐
34 Air Bags / Air Suspension	☒	☐	☐
35 Shock Absorbers	☒	☐	☐
36 Axles / Cross Members	☒	☐	☐
Oil / Fuel Leaks			
37 Engine / Driveline	☒	☐	☐
38 Steering / Accessories	☒	☐	☐
Exhaust			
39 Leaks / Design / Security	☒	☐	☐
40 Emissions	☒	☐	☐
Mountings			
41 Engine / Transmission	☒	☐	☐
42 Body	☒	☐	☐
Air Systems			
43 Leaks / Low Air Warning / Contamination	☒	☐	☐
44 Breakaway Protection	☒	☐	☐
Under body / Chassis			
45 Cracks / Security	☒	☐	☐
46 Corrosion	☒	☐	☐
Mudguards / Mud Flaps			
47 Fitted as Required	☒	☐	☐

Notes:

1. If manufacture specifications are unknown refer to the Heavy Vehicle Inspection Manual for minimum requirements.
2. For a heavy vehicle built after 1930, the service brake must bring the vehicle or combination to a stop within 16.5m from a speed of 35km/h.
3. Trailer breakaway protection must be checked for operation.

Name: **Andrew Brandt**

Signature: *A Brandt*



BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD 14037
ABN 35 108 043 312

SERVICE REPORT No. S 3063

Day: Monday Date: 31/01/2022

MCKENNA GROUP
PTY LTD

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Klms: 77,486km	Hours:
----------------------------------	--------------	--------------------	----------------	--------

☐ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)

Check Fault Repair Log and carry out necessary repairs.	Check brake system for leaks (service and main).
Grease all lubrication points.	Drain condensation from air tanks.
Lift cab/boom, grease pivot, check condition and tension of belts.	Check steering joints and linkages.
Check power steering for fluid levels and leaks.	Inspect for any obvious faults in suspension, structure or bodywork.
Check/rop up engine oil and coolant level.	Visual check of airbag suspension where fitted.
Check transmission and differential for fluid levels and leaks.	Inspect wheel nuts and wheels for security, tyre tread and inflation.
Check driveline and universal joints.	Check number plates, all labels for due date condition and security.
Check all lights and reflectors.	Check for visible exhaust emissions and lack of engine power.
Check horn, instruments, gauges, wipers and washers.	Fault #/s Rectified (if Applicable)
Check battery terminals and security.	
Inspect brake lining wear/travel and adjust if required.	

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.	Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/travel and adjust if required.	Visual check of airbag suspension where fitted.
Check all lights and reflectors.	Check number plate, and all labels due date, condition and security.
Check condition of air lines and electrical cables.	Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security, tyre tread and inflation.	Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	

Notes:

Fit 4 new batteries to truck

☐ B SERVICE CHECKLIST Including Items from Checklist A

☒ TRUCK (Approx 20,000km)

All components of "A" Service.	Check wear/movement in pitman arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	Check trailer breakaway and maxi system.
Test coolant and change water filters if required.	
Check battery electrolyte level, terminals and security.	Fault #/s Rectified (if Applicable)
Check clutch linkage, clutch brake operation and adjustment.	
Check front steering hub oil level.	

☐ C SERVICE CHECKLIST Including Items from Checklist A and B

☐ TRUCK (Approx 200,000kms or annually)

All components of "A" and "B" Services.	Change PTO Hydraulic filters.
Change power steering oil and filter.	Service air dryers where applicable.
Change transmission oil and filter (300,000kms for Synchromesh).	Re-torque all "U" bolts and cross members.
Change differential oil and filter.	Fault #/s Rectified (if Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	
Check clutch linkage, clutch brake operation and adjustment.	

The person completing the service is to print their name and sign.

Name: Andrew Brandt

Signature: A Brandt

Date: 31/01/2022

OFFICE USE ONLY Entered By:

Name: A. McKenna

Signature: A McKenna

Date: 4, 2, 22

NORTHSIDE DIESEL

Truck & 4X4 Repairs and Spares

Tax Invoice

04/06/2021

63621

Invoice #:

Big Rig Repairs T/As Northside Diesel
24 Commercial Drive

Caboolture, QLD 4510

Brendan McKenna Earthmoving Pty Ltd
11 Montego Crt

Eatons Hill, QLD 4037

0417710806

0418717154

Phone 0754954133

Email workshop@northsidediesel.com.au

Web www.northsidediesel.com.au

A.B.N. 30 135 177 123

Fax

Registration MCKDOG

Make Mack

Model Superliner

Colour White

Odometer/Hrs 59489 / 1075

VIN 6FMT16FMT14H83JD8097

Item	Description	Quantity	Unit Price	Total
Labour - Engine light				
Labour - Engine light				\$885.50
Pipe Set		1.00	\$315.46	\$347.01
Cable Joint		3.00	\$2.10	\$6.93
Cable Terminal		3.00	\$1.70	\$5.61
Housing		1.00	\$11.80	\$12.98
Cable Joint		1.00	\$2.10	\$2.31
Labour - Service				
Labour - Service				\$506.00
Mack MP8 & MP10 Filter Kit		1.00	\$150.00	\$165.00
VDS4		52.00	\$7.96	\$455.31
Consumables		1.00	\$14.00	\$15.40
Waste Services		1.00	\$17.95	\$19.75
Steam Clean		1.00	\$17.36	\$19.10
Grease		1.00	\$16.70	\$18.37
Subtotal				\$2235.69
Rounding				\$-0.01
GST				\$223.57
Total				\$2459.25
Payment Terms:			Balance Due	\$2459.25

Invoice Notes

Carry out service as per Mack Service sheet

Engine light on dash.

Complete guided diagnostics using Volvo tech tool, confirm exhaust back pressure fault.

Complete check of all wiring - All ok

Complete checks of all plugs and complete pin tension test - Find pin into and on back pressure sensor faulty. Replace back pressure sensor and pins in plkg and test drive - All ok

Note that our Banking details are Account Name Big Rig Repairs Pty Ltd | BSB 014 305 | Account Number 472216723

Please remember to note the INVOICE or QUOTE number on your EFT remittance.



MCKENNA GROUP
PTY LTD

**BRENDAN MCKENNA
EARTHMOVING**
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3034

Day: Wednesday Date: 13/01/2021

Vehicle/Trailer: Mack Suppliner	Rego: MCKDOG	MCK Unit No. MCK74	Klms: 42612	Hours: -
---------------------------------	--------------	--------------------	-------------	----------

☐ **A SERVICE CHECKLIST**

☒ TRUCK (Approx 10,000km - 12,000km)	☒	☒	☒	☒
Check Fault Repair Log and carry out necessary repairs.	☒	Check brake system for leaks (service and main).	☒	☒
Grease all lubrication points.	☒	Drain condensation from air tanks.	☒	☒
Lift cab/bonnet, grease pivots, check condition and tension of belts.	☒	Check steering joints and linkages.	☒	☒
Check power steering for fluid levels and leaks.	☒	Inspect for any obvious faults in suspension, structure or bodywork.	☒	☒
Check/top up engine oil and coolant level.	☒	Visual check of all bag suspension where fitted.	☒	☒
Check transmission and differential for fluid levels and leaks.	☒	Inspect wheel nuts and wheels for security, tyres for tread and inflation.	☒	☒
Check driveline and universal joints.	☒	Check number plates, all labels for due date condition and security.	☒	☒
Check all lights and reflectors.	☒	Check for visible exhaust emissions and lack of engine power.	☒	☒
Check horn, instruments, gauges, wipers and washers.	☒	Fault #/s Rectified (if Applicable)	☒	☒
Check battery terminals and security.	☒	98081	☒	☒
Inspect brake lining wear/travel and adjust if required.	☒		☒	☒

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.	☒	Inspect for any obvious faults in suspension, structure or bodywork.	☒
Inspect brake lining wear/travel and adjust if required.	☒	Visual check of all bag suspension where fitted.	☒
Check all lights and reflectors.	☒	Check number plate, and all labels due date, condition and security.	☒
Check condition of air lines and electrical cable.	☒	Re-torque all "U" bolts and cross members.	☒
Inspect wheel nuts and wheels for security, tyres for tread and inflation.	☒	Fault #/s Rectified (if Applicable)	☒
Change oil in oil filled wheel bearings and check other wheel bearings.	☒		☒

Notes:

☒ **B SERVICE CHECKLIST Including Items from Checklist A**

☒ TRUCK (Approx 20,000km)	☒	☒	☒	☒
All components of "A" Service.	☒	Check wear/movement in pinion arm, drag arm, tie rods and spring shackles.	☒	☒
Change engine oil and filters.	☒	Replace or clean air cleaner as required.	☒	☒
Change fuel filters and bleed and check for leaks.	☒	Check trailer breakaway and mast system.	☒	☒
Test coolant and change water filters if required.	☒		☒	☒
Check battery electrolyte level, terminals and security.	☒	Fault #/s Rectified (if Applicable)	☒	☒
Check clutch linkage, clutch brake operation and adjustment.	☒		☒	☒
Check front steering hub oil level.	☒		☒	☒

☐ **C SERVICE CHECKLIST Including Items from Checklist A and B**

☒ TRUCK (Approx 200,000kms or annually)	☒	☒	☒	☒
All components of "A" and "B" Service.	☒	Change PTO Hydraulic filters.	☒	☒
Change power steering oil and filter.	☒	Service air dryers where applicable.	☒	☒
Change transmission oil and filter (300,000kms for Synthetic Oil).	☒	Re-torque all "U" bolts and cross members.	☒	☒
Change differential oil and filter.	☒	Fault #/s Rectified (if Applicable)	☒	☒
Change oil in oil filled wheel bearings and check other wheel bearings.	☒		☒	☒
Check clutch linkage, clutch brake operation and adjustment.	☒		☒	☒

The person completing the service is to print their name and sign.

Name: Matthew Harris

Signature: *Matthew Harris*

Date: 13/01/2021

OFFICE USE ONLY Entered By:

Name: *Angela Mckenna*

Signature: *Angela Mckenna*

Date: 16/01/21



Tax Invoice

Invoice #: 00048391

PO Box 551
Bribie Island Qld 4507



Ph 07 5499 1049
Fax 07 5499 3643
Email sales@timstyresandauto.com.au
A.B.N. 82 505 142 194

Ship To: **Brendan McKenna
Earthmoving Pty-Ltd
11 Montego Court
Eatons hill QLD 4037**

Bill To:

**Brendan McKenna
Earthmoving Pty-Ltd
11 Montego Court
Eatons hill QLD 4037**

Vehicle Type / Rego		Odometer	Order No	TERMS	DATE	
Mack MCKDOG		41,975 km	Brendon	Net 30th after EOM	23/12/2020	
QTY	ITEM	DESCRIPTION	Price Per	UNIT	Total Price Exc GST	Tax Code
2	MI29580225MZ	Michelin 295/8022.5 Multi Z	\$686.365		\$1,372.73	G S T
2	TRWBALA	Wheel Balance (Truck) (Alloy)	\$35.00		\$70.00	G S T
2	WH900225	Wheel 9.00x22.5 335POD 1060SET Offset Alloys (Euro Fitment)	\$531.815		\$1,063.63	G S T
	/COMMENT	Tyres and wheels supplied and fitted 23/12/20				G S T
	SERdoc	Service Docket 51371 23/12/20				G S T
					SALE AMT.	\$2,506.36
					GST	\$250.64
					TOTAL AMT.	\$2,757.00
					PAID TODAY	\$0.00
					BALANCE DUE	\$2,757.00

Preferred payment is by direct deposit to Westpac BSB 034119 Account 172104.
Please quote your business name and/or invoice number for ease of allocation.
(creditor) watch

Note our payment terms are strictly 30 days from end of month.



MCKENNA GROUP
PTY LTD

BRENDAN MCKENNA
EARTHMOVING

MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

TRUCK & TRAILER ANNUAL INSPECTION

No. AS321

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

Day Friday

Date 23/10/2020

Registration Number:	Make and Body Type:	Klms:	Unit No.:
MCKDOG	Mack Superliner Prime Mover	35802	MCK74

Note: Cross out whichever is not applicable

☐ OK

Satisfactory

☒ X

Defective

LIGHTING EQUIPMENT		SEAT BELTS		MOUNTINGS	
Battery Cradle/Security	OK	Fitted as required	OK	Engine	OK
Headlights/Auxiliary Lights	OK	Operation	OK	Transmission	OK
Park Lights	OK	Webbing/Fittings	OK	Body	OK
Tail Lights	OK	Anchorage	OK	STEERING	
Break Lights	OK	MUDGUARDS/MUDFLAPS		Free Play/Seals	OK
Reflectors/Marker Plates	OK	Fitted as Required	OK	Steering Box/Pitman Arm	OK
Clearance Lights	OK	Spray Suppression	OK	Arms/Linkages	OK
Number Plate Light	OK	SIDE & BODY PANELS		King Pins/Bushes	OK
Reversing Light	OK	Cracks/Security	OK	Steering Wheel	OK
TURN SIGNALS		Corrosion/Damage	OK	SUSPENSION	
Operation	OK	FITTINGS & PROTRUSIONS		Shock Absorbers	OK
Colour	OK	Corrosion/Damage	OK	Cross Members	OK
Visibility	OK	Door/Bonnet/Catches	OK	Axles	OK
WARNING DEVICE		Rear Vision Mirrors	OK	Springs/U Bolts	OK
Control	OK	Body Fittings/Bumper Bars	OK	Air Bags/Air Suspension	OK
Audibility	OK	EXHAUST SYSTEM		Hangers/Pins/Bushes	OK
WIPERS/WASHERS		Leaks/Design/Security	OK	Bolts/Locknuts/Pins	OK
Blades/Insert	OK	Emission	OK	WHEELS & TYRES	
Controls/Motor	OK	UNDER BODY & CHASSIS		Wheels/Security	OK
GLAZING		Cracks/Security/Corrosion	OK	Tyres	OK
Material/Visibility	OK	OIL LEAKS		Wheel Bearings	OK
Window Operation	OK	Engine	OK	BRAKING SYSTEM	
SEATS		Transmission	OK	Service Brake	OK
Mounting/Construction	OK	Differential/s	OK	Park Brake	OK
Fitting/Operation	OK	Steering/Accessories	OK	TOW COUPLINGS	
Condition	OK	AIR SYSTEM		King Pin/Skid Plate/Auto	N/A
SPEED LIMITER		Leaks/Contamination	OK	Turntable/Ringfeeder/Ball Race	OK
Speed Limiter operational and has not been tampered with	OK	Breakaway/Protection Valve	OK	Tow Eye/Draw Bar/Safety Chains	N/A

DETAILS OF ITEMS REJECTED

CERTIFICATION

I certify the above information is true and that the vehicle is in a safe and thoroughly serviceable condition

Mechanic's Name: Matthew Harries

Mechanic's Signature:

Date: 23/10/2020

OFFICE USE ONLY Entered By:

Name: Angela McKenna

Signature:

Date: 27/10/20



MCKENNA GROUP
PTY LTD

BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

SERVICE REPORT No. S 3033

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

Day: Saturday Date: 10/10/2020

Vehicle/Trailer: Mack Superliner	Rego: MCKDOG	MCK Unit No. MCK74	Klms: 34245	Hours: -
----------------------------------	--------------	--------------------	-------------	----------

☐ **A SERVICE CHECKLIST**

☐ TRUCK (Approx 10,000km - 12,000km)	☒
Check Fault Repair Log and carry out necessary repairs.	☒
Grease all lubrication points.	☒
Lift cap/breast, grease pivot, check condition and tension of belts.	☒
Check power steering for fluid levels and leaks.	☒
Check/top up engine oil and coolant level.	☒
Check transmission and differential for fluid levels and leaks.	☒
Check driveline and universal joints.	☒
Check all lights and reflectors.	☒
Check horn, instruments, gauges, wheels and wipers.	☒
Check battery terminals and security.	☒
Inspect brake lining wear/brand and adjust if required.	☒

☐ **TRAILER (Approx 6 monthly/annually)**

Grease all lubrication points.	☐
Inspect brake lining wear/brand and adjust if required.	☐
Check all lights and reflectors.	☐
Check condition of air lines and electrical cable.	☐
Inspect wheel nuts and wheels for security, tyres for wear and inflation.	☐
Change oil in all filled wheel bearings and check other wheel bearings.	☐

Notes:

☐ **B SERVICE CHECKLIST Including items from Checklist A**

☐ TRUCK (Approx 20,000km)	☒
All components of "A" Service.	☒
Change engine oil and filters.	☒
Change fuel filters and bleed and check for leaks.	☒
Test coolant and change water filters if required.	☒
Check battery electrolyte level, terminals and security.	☒
Check clutch linkage, clutch brake operation and adjustment.	☒
Check front steering hub oil level.	☒
Check wear/movement in pinion arm, drag arm, tie rods and spring shackles.	☒
Replace or clean air cleaner as required.	☒
Check trailer breakaway and mast system.	☒
Fault #/s Rectified (if Applicable)	

☒ **C SERVICE CHECKLIST Including items from Checklist A and B**

☒ TRUCK (Approx 200,000km or annually)	☒
All components of "A" and "B" Services.	☒
Change power steering oil and filter.	☒
Change transmission oil and filter (300,000km for Synthetic Oil).	☒
Change differential oil and filter.	☒
Change oil in oil filled wheel bearings and check other wheel bearings.	☒
Check clutch linkage, clutch brake operation and adjustment.	☒
Change PTO Hydraulic filters.	☒
Service air dryers where applicable.	☒
Re-torque all "U" bolts and cross members.	☒
Fault #/s Rectified (if Applicable)	

The person completing the service is to print their name and sign.

Name: Matthew Harries

Signature: *Matthew Harries*

Date: 10/10/2020

OFFICE USE ONLY Entered By: *Angela Wicks*

Name: *Angela Wicks*

Signature: *Angela Wicks*

Date: 10/10/20



MCKENNA GROUP
PTY LTD

BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill QLD 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3031

Day: Tuesday Date: 02/06/2020

Vehicle/Trailer: Mack Superliner

Rego: MCKDOG

MCK Unit No. MCK74

Klms: 21976

Hours: -

A SERVICE CHECKLIST

TRUCK (Approx 10,000km - 12,000km)

Check Fault Repair Log and carry out necessary repairs.	✓	Check brake system for leaks (service and max).	✓
Grease all lubrication points.	✓	Drain condensation from air tanks.	✓
Lift cab/pommel, grease pivots, check condition and tension of belts.	✓	Check steering joints and linkages.	✓
Check power steering for fluid levels and leaks.	✓	Inspect for any obvious faults in suspension, structure or bodywork.	✓
Check/top up engine oil and coolant level.	✓	Visual check of air/dag suspension where fitted.	✓
Check transmission and differential for fluid levels and leaks.	✓	Inspect wheel nuts and wheels for security, tyres for tread and inflation.	✓
Check driveline and universal joints.	✓	Check number plates, all labels for due date condition and security.	✓
Check all lights and reflectors.	✓	Check for visible exhaust emissions and lack of engine power.	✓
Check horn, instrument gauges, wipers and washers.	✓	Fault #/s Rectified (if Applicable)	
Check battery terminals and security.	✓		
Inspect brake lining wear/travel and adjust if required.	✓		

TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.	
Inspect brake lining wear/travel and adjust if required.		Visual check of air/dag suspension where fitted.	
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.	
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.	
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			

Notes:

B SERVICE CHECKLIST Including Items from Checklist A

TRUCK (Approx 20,000km)

All components of "X" Service.	✓	Check wear/movement in human arm, drag arm, tie rods and spring shackles.	✓
Change engine oil and filters.	✓	Replace or clean air cleaner as required.	✓
Change fuel filters and bleed and check for leaks.	✓	Check trailer brackway and mast system.	✓
Treat coolant and change water filters if required.	✓		
Check battery electrolyte level, terminals and security.	✓	Fault #/s Rectified (if Applicable)	
Check clutch linkage, clutch brake operation and adjustment.	✓		
Check front steering hub oil level.	✓		

C SERVICE CHECKLIST Including Items from Checklist A and B

TRUCK (Approx 200,000kms or annually)

All components of "X" and "B" Service.		Change PTO Hydraulic filters.	
Change power steering oil and filter.		Service air dryers where applicable.	
Change non-oxidation oil and filter (300,000km for Synthetic Oil).		Re-torque all "U" bolts and cross members.	
Change differential oil and filter.		Fault #/s Rectified (if Applicable)	
Change oil in oil filled wheel bearings and check other wheel bearings.			
Check clutch linkage, clutch brake operation and adjustment.			

The person completing the service is to print their name and sign.

Name: Matthew Harries

Signature:

Date: 02/06/2020

OFFICE USE ONLY Entered By:

Name: Angela Wickham

Signature:

Date: 5/6/20



MCKENNA GROUP
PTY LTD

BRENDAN MCKENNA
EARTHMOVING
MCKENNA HAULAGE

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 35 108 043 312

SERVICE REPORT No. S 3006

Day: Tuesday Date: 10/03/2020

Vehicle/Trailer: Mack superliner	Rego: MCKDOG	MCK Unit No. MCK74	Klms: 10100	Hours: -
----------------------------------	--------------	--------------------	-------------	----------

☒ A SERVICE CHECKLIST

☒ TRUCK (Approx 10,000km - 12,000km)

✓	Check Fault Repair Log and carry out necessary repairs.	✓	Check brake system for leaks (service and max).	✓
✓	Grease all lubrication points.	✓	Drain condensation from air tanks.	✓
✓	Lift cab/bonnet, grease pivots, check condition and tension of belts.	✓	Check steering joints and linkages.	✓
✓	Check power steering for fluid levels and leaks.	✓	Inspect for any obvious faults in suspension, structure or bodywork.	✓
✓	Check/top up engine oil and coolant level.	✓	Visual check of airbag suspension where fitted.	✓
✓	Check transmission and differential for fluid levels and leaks.	✓	Inspect wheel nuts and wheels for security, tyres for tread and inflation.	✓
✓	Check driveline and universal joints.	✓	Check number plates, all labels for due date condition and security.	✓
✓	Check all lights and reflectors.	✓	Check for visible exhaust emissions and lack of engine power.	✓
✓	Check horn, instruments, gauges, wipers and washers.	✓	Fault #/s Rectified (If Applicable)	
✓	Check battery terminals and security.	✓		
✓	Inspect brake lining wear/travel and adjust if required.	✓		

☐ TRAILER (Approx 6 monthly/annually)

Grease all lubrication points.		Inspect for any obvious faults in suspension, structure or bodywork.
Inspect brake lining wear/travel and adjust if required.		Visual check of airbag suspension where fitted.
Check all lights and reflectors.		Check number plate, and all labels due date, condition and security.
Check condition of air lines and electrical cable.		Re-torque all "U" bolts and cross members.
Inspect wheel nuts and wheels for security, tyres for tread and inflation.		Fault #/s Rectified (If Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.		

Notes:

Truck is as new and everything in good working order.

☐ B SERVICE CHECKLIST Including items from Checklist A

☒ TRUCK (Approx 20,000km)

All components of "A" Service.	Check wear/movement in pitman arm, drag arm, tie rods and spring shackles.
Change engine oil and filters.	Replace or clean air cleaner as required.
Change fuel filters and bleed and check for leaks.	Check trailer breakaway and main system.
Test coolant and change water filters if required.	
Check battery electrolyte level, terminals and security.	Fault #/s Rectified (If Applicable)
Check clutch linkage, clutch brake operation and adjustment.	
Check front steering hub oil level.	

☐ C SERVICE CHECKLIST Including items from Checklist A and B

☐ TRUCK (Approx 200,000kms or annually)

All components of "A" and "B" Services.	Change PTO Hydraulic filters.
Change power steering oil and filter.	Service air dryers where applicable.
Change transmission oil and filter (300,000Kms for Synthetic Oil).	Re-torque all "U" bolts and cross members.
Change differential oil and filter.	Fault #/s Rectified (If Applicable)
Change oil in oil filled wheel bearings and check other wheel bearings.	
Check clutch linkage, clutch brake operation and adjustment.	

The person completing the service is to print their name and sign.

Name: Matthew Harries

Signature:

Date: 10/03/2020

OFFICE USE ONLY Entered By:

Name: A. McKenna

Signature:

Date: 12 / 04 / 2020



BRENDAN MCKENNA
EARTHMOVING PTY LTD

BRENDAN MCKENNA EARTHMOVING PTY LTD

M 0417 710 806

F 07 3264 5661

E accounts@mckgroup.com.au

11 Montego Court

Eatons Hill QLD 4037

ABN 94 163 887 563

Docket No. PS-103553

Day Friday

Date 05/09/2025

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☐ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxo (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxo (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☒ Other: Drop Deck Semi Trailer
MACHINE REGO NO.:	MCK DOG	TRAILER REGO NO.:	YQ56RR
MCK UNIT NO.:	MCK 74	HOUR METRE/ KM READING:	212994



OK, No obvious defect



Fault identified, use report below



NA Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK

Cabin - Access, egress seating, seatbelts, loose objects, controls, rOPS or fOPS	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	IN/A
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsory signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: R. Broadhurst

Signature:

Date: 05/09/2025



BRENDAN MCKENNA
EARTHMOVING PTY LTD

BRENDAN MCKENNA EARTHMOVING PTY LTD

M 0417 710 806

F 07 3264 5661

E accounts@mckgroup.com.au

11 Montego Court

Eatons Hill | QLD | 4037

ABN 94 163 887 563

Docket No. PS-103048

Day Thursday

Date 08/05/2025

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☒ B Double ☐ Bobcat ☐ Combo ☐ Dozer (D6) ☐ Dozer (D7) ☐ Dozer (D8) ☐ End Loader ☐ Excavator (5t) ☐ Excavator (8t)	☐ Excavator (14t) ☐ Excavator (22t) ☐ Excavator (30t) ☐ Excavator (48t) ☐ GPS ☐ Grader 140H ☐ Grader 140M ☐ Grader 150 AWD ☐ Labour	☐ Low Loader ☐ Moxi (30t) ☐ Moxi (40t) ☐ Tractor ☐ Mulcher 175 ☐ Mulcher 300 ☐ Positrack ☐ Quadtrac ☐ Roller-Drawn	☐ Roller-Flat ☐ Roller-Multi ☐ Scraper ☐ Semi Trailer ☐ Side Tipper ☐ Tandem Tipper ☐ Truck & Dog ☐ Water Truck ☐ Other:
MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	YQ-55RR & YQ-56RR
MCK UNIT NO.:	MCK74	HOUR METRE/ KM READING:	203017km



OK, No obvious defect



Fault identified, use report below



Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK

Cabin - Access, egress seating, seatbelts, loose objects, controls, rOPS or fOPS:	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime:	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure:	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses:	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security:	OK
Hydraulics - Rams, hoses, leaks, wear:	OK	Hitch (safety pin) - Wear:	N/A
Leaks - Engine, transmission, final drives, cooling systems, fuel, air:	OK	Articulated joint/linkage:	OK
Brakes - Emergency & service, brake failure indicator, pressure/vacuum gauges:	OK	Plant security:	OK
Compulsary signs, reflective tape, reflectors:	OK	Bleed off contaminants from air tanks:	OK
Tow/Couplings/Drawbars for security & integrity:	OK	NHVAS Label fitted, not obscured, not damaged:	OK
NHVAS Interception Book in vehicle:	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: Robert Brandt

Signature: Robert

Date: 08/05/2025



BRENDAN MCKENNA
EARTHMOVING PTY LTD

BRENDAN MCKENNA EARTHMOVING PTY LTD

M 0417 710 806

F 07 3264 5661

E accounts@mckgroup.com.au

11 Montego Court

Eatons Hill | QLD | 4037

ABN 94 163 887 563

Docket No. PS-102855

Day Wednesday

Date 05/03/2025

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☒ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxy (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxy (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☐ Other:

MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	044-UBG
MCK UNIT NO.:	MCK74	HOUR METRE/ KM READING:	198837km



OK, No obvious defect



Fault identified, use report below



Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK

Cabin - Access, egress seating, seatbelts, loose objects, controls, ropes or fops	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	OK
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	X	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsory signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

Slow coolant leak, rotating Beacon on float not working. Spoke to Brendan.

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: Robert Brandt

Signature: Robert

Date: 05/03/2025

Closed Western GPS
Truck 18/3/25



BRENDAN MCKENNA
EARTHMOVING PTY LTD

BRENDAN MCKENNA EARTHMOVING PTY LTD

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 94 163 887 563

Docket No. PS-102830

Monday
Day
Date 24/02/2025

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☒ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxy (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxy (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☐ Other:

MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	044-UBG
MCK UNIT NO.:	MCK74	HOURLY METRE/ KM READING:	197223km

☒ OK, No obvious defect ☒ Fault identified, use report below ☒ N/A Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK			
Cabin - Access, egress seating, seatbelts, loose objects, controls, rOPS or fOPS	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	N/A
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsary signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: Robert Brandt Signature: Robert Date: 24/02/2025



BRENDAN McKENNA
EARTHMOVING PTY LTD

BRENDAN McKENNA EARTHMOVING PTY LTD

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 94 163 887 563

Docket No. PS-102225

Day Monday

Date 23/07/2024

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☒ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxy (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxy (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☐ Other:

MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	257-QSZ
MCK UNIT NO.:	MCK74	HOUR METRE/ KM READING:	178323km

☒ OK, No obvious defect	☒ Fault identified, use report below	☐ NA Item not applicable to machine or operator
---	--	--

BEFORE COMMENCING, OPERATORS CHECK			
Cabin - Access, egress seating, seatbelts, loose objects, controls, rOPS or fOPS	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body. Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	OK
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsary signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: Robert Brandt Signature: Robert Date: 22/07/2024



BRENDAN McKENNA
EARTHMOVING PTY LTD

BRENDAN McKENNA EARTHMOVING PTY LTD

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 94 163 887 563

Docket No. **PS-102143**

Day **Friday**
Date **28/06/2024**

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☐ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxy (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxy (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☒ Other: Drop Deck Semi Trailer

MACHINE REGO NO.:	MCK DOG	TRAILER REGO NO.:	YQ56RR
MCK UNIT NO.:	MCK74	HOUR METRE/ KM READING:	176431 kms

☒ OK, No obvious defect
 ☒ Fault identified, use report below
 ☐ N/A Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK

Cabin - Access, egress seating, seatbelts, loose objects, controls, ropes or fops	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	N/A
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsary signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: **R. Broadhurst**

Signature: **B**

Date: **28/06/2024**



BRENDAN MCKENNA
EARTHMOVING PTY LTD



BRENDAN MCKENNA
EARTHMOVING PTY LTD

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill | QLD | 4037
ABN 94 163 887 563

Docket No. PS-100055

Day Thursday

Date 16/02/2023

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☐ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxy (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxy (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☐ Other:

MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	044-UBG
MCK UNIT NO.:	MCK74	HOURLY METRE/ KM READING:	123558km

☒ OK, No obvious defect
 ☒ Fault identified, use report below
 ☐ N/A Item not applicable to machine or operator

BEFORE COMMENCING, OPERATORS CHECK			
Cabin - Access, egress seating, seatbelts, loose objects, controls, rOPS or fOPS	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body, Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure, thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	OK
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsory signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: Robert Brandt

Signature: Robert

Date: 16/02/2023



BRENDAN MCKENNA
EARTHMOVING PTY LTD

BRENDAN MCKENNA EARTHMOVING PTY LTD

M 0417 710 806
F 07 3264 5661
E accounts@mckgroup.com.au

11 Montego Court
Eatons Hill [QLD] 4037
ABN 94 163 887 563

Docket No. **PS-99993**

Day **Tuesday**
Date **31/01/2023**

DAILY PLANT INSPECTION CHECKLIST

PLANT OPERATOR DAILY SAFETY CHECKLIST: Operators are required to check the following items before commencing work. These records form the basis of a plant maintenance procedure and will be subject to random inspection.

☐ B Double	☐ Excavator (14t)	☐ Low Loader	☐ Roller-Flat
☐ Bobcat	☐ Excavator (22t)	☐ Moxi (30t)	☐ Roller-Multi
☐ Combo	☐ Excavator (30t)	☐ Moxi (40t)	☐ Scraper
☐ Dozer (D6)	☐ Excavator (48t)	☐ Tractor	☐ Semi Trailer
☐ Dozer (D7)	☐ GPS	☐ Mulcher 175	☐ Side Tipper
☐ Dozer (D8)	☐ Grader 140H	☐ Mulcher 300	☐ Tandem Tipper
☐ End Loader	☐ Grader 140M	☐ Positrack	☐ Truck & Dog
☐ Excavator (5t)	☐ Grader 150 AWD	☐ Quadtrac	☐ Water Truck
☐ Excavator (8t)	☐ Labour	☐ Roller-Drawn	☐ Other: _____

MACHINE REGO NO.:	MCKDOG	TRAILER REGO NO.:	
MCK UNIT NO.:	MCK74	HOUR METRE/ KM READING:	122293km

☒ OK, No obvious defect	☐ Fault identified, use report below	☐ N/A Item not applicable to machine or operator
---	---	---

BEFORE COMMENCING, OPERATORS CHECK

Cabin - Access, egress seating, seatbelts, loose objects, controls, ropes or fops	OK	Misc - Air con, fire extinguisher	OK
Visibility - Windscreen, windows, wipers, washers, mirrors for security damage & grime	OK	Damage to - Panels/guards - Cracks to chassis/frame/body; Structure & body work - all panels & structural members secure	OK
Electrical System - Lights, amber beacon, horn, rev travel alarm, all reflectors & lenses	OK	Wheels, tyres, tracks - Wear/tension/pressure; thread integrity & wheel security	OK
Hydraulics - Rams, hoses, leaks, wear	OK	Hitch (safety pin) - Wear	N/A
Leaks - Engine, transmission, final drives, cooling systems, fuel, air	OK	Articulated joint/linkage	OK
Brakes - Emergency & service, break failure indicator, pressure/vacuum gauges	OK	Plant security	OK
Compulsory signs, reflective tape, reflectors	OK	Bleed off contaminants from air tanks	OK
Tow/Couplings/Drawbars for security & integrity	OK	NHVAS Label fitted, not obscured, not damaged	OK
NHVAS Interception Book in vehicle	OK		

DETAILS OF FAULTS OR DEFECTS AND ACTION TAKEN:

The individual who carries out the check must understand that he or she is certifying the vehicle is safe to the limits of the inspection when the vehicle leaves the yard or depot.

Operator Name: **Robert Brandt** Signature: **Robert** Date: **31/01/2023**